

# INSTRUCTIONS MANUAL ELECTRONIC CRANE SCALE



## MCW PROFESSIONAL



## MCWR2 PROFESSIONAL "INOX VERSION"



## MCWK PROFESSIONAL



# INDEX

<b>1 GENERAL INFORMATION .....</b>	<b>3</b>
<b>1.1 INTRODUCTION .....</b>	<b>3</b>
1.1.1 Designation of the machine and manufacturer data .....	3
1.1.2 Premises .....	3
1.1.3 Symbols.....	4
1.1.4 General precepts .....	5
1.1.5 Destination of use.....	5
1.1.6 Typical CE conformity declaration .....	6
1.1.7 Markings.....	7
1.1.8 Periodic metrological verification .....	10
1.1.9 Directives and reference norms .....	10
<b>1.2 TECHNICAL FEATURES OF THE WEIGHING SYSTEM.....</b>	<b>11</b>
1.2.1 Main components .....	11
1.2.2 Crane scale dimensions .....	14
1.2.3 Size of shackles and hooks .....	17
1.2.4 Electronic device features .....	18
1.2.5 Load cell features .....	19
1.2.6 Indicator environmental features .....	19
1.2.7 Remote control: keys and commands .....	20
1.2.8 Radio module features (only for model with radio module) .....	20
<b>1.3 GENERAL SAFETY NORMS .....</b>	<b>21</b>
1.3.1 Laws and national norms .....	21
1.3.2 General warnings .....	21
1.3.3 Organisational measures of the user company .....	22
1.3.4 Indications and warnings regarding the crane scale .....	23
1.3.5 Indications and bans for working in safe conditions .....	24
1.3.6 Environmental conditions .....	24
<b>2 USER MANUAL .....</b>	<b>25</b>
<b>2.1 USER.....</b>	<b>25</b>
2.1.1 Professional features.....	25
2.1.2 Location.....	25
2.1.3 Clothing and equipment .....	25
<b>2.2 DESCRIPTION OF THE MACHINES AND CONTROLS .....</b>	<b>26</b>
2.2.1 Power supply – Start-up – Switch-off .....	26
2.2.2 Front panel keys and indicators .....	27
2.2.3 Front panel keys and indicators .....	28
2.2.4 Symbols on the LCD display(MCW).....	30
<b>2.3 BASIC FUNCTIONS.....</b>	<b>32</b>
2.3. 1 Functioning with remote control .....	32
<b>2.4 FUNCTIONING.....</b>	<b>33</b>
2.4.1 Quick reference .....	33
2.4.2 Functioning modes .....	34
<b>3 TECHNICAL INFORMATION .....</b>	<b>35</b>
<b>3.1 PACKAGING, TRANSPORT, HANDLING, STORAGE, AND INSTALLATION .....</b>	<b>35</b>
3.1.1 Packaging.....	35
3.1.2 Transport, handling, storage .....	35
3.1.3 Installation .....	36
<b>3.2 MAINTENANCE AND CHECKS.....</b>	<b>36</b>
3.2.1 Daily monitoring.....	36
3.2.2 Regular Maintenance .....	37
3.2.3 Maintenance registry .....	40
3.2.4 Clean.....	41
3.2.5 Replacing the remote control batteries .....	41
3.2.6 Electronic crane scale battery: instructions and recharge .....	42
3.2.7 The battery recharge by optional kit.....	43
<b>3.3 DECOMMISSIONING AND DISPOSAL .....</b>	<b>46</b>
<b>4 WARRANTY .....</b>	<b>47</b>

# 1 GENERAL INFORMATION

## 1.1 INTRODUCTION

*Dear Customer,*

*We thank you for choosing a Dini Argeo product and we invite you to carefully read this manual before carrying out any operation on the instrument that you have purchased.*

*It is of utmost importance that the main checks and maintenance or repair interventions be recorded in the appropriate section of the booklet.*

*Therefore we kindly ask you to carefully keep this booklet and present it to the manufacturer Dini Argeo or to the authorised reseller each time that it is necessary to carry out maintenance, repair, or replace spare parts / accessories on the instrument.*

### **NOTE:**

This manual is an integral part of the instrument and if sold, it must be given to the new owner.

#### **1.1.1 Designation of the machine and manufacturer data**

The "MCW/MCWK" instrument is an electronic weighing device, to be considered as a lifting accessory, suitable for use on overhead cranes, or on similar lifting devices.

It is composed by a tension load cell, an electronic device to measure and indicate the weight, a shackle connecting the hook of the lifting means and the load cell, and an eye hook for the connection between swivel hook and load lifting devices.

Normally the remote command of the measuring instrument takes place through an infrared ray system.

It is possible also to use radio devices both for the remote commands as well as for the data transmission (RF).

With a regard to the load cell and its components sizes, the equipment can have different maximum capacities; in kilograms there are: 150, 300, 600, 1500, 3000, 6000, 6500, 8000.

The instrument can be suitable for use with third parties (M) or for internal use.

The complete identification will then be:

MCW + (150 or 300 or 600 or 1500 or 3000 or T6) + (M – only if for use with third) or MCW + (150 or 300 or 600 or 1500 or 3000 or T6) if the instrument would be suitable at an internal usage.

MCWK6 (3000 kg or 6000 kg) + (M – only if for use with third) or MCWK6 if the instrument would be suitable at an internal usage.

MCWK8 (6000 kg or 8000 kg) + (M – only if for use with third) or MCWK8 if the instrument would be suitable at an internal usage. For more information see paragraph "MARKINGS".

This manual takes into consideration the various types.

#### **MANUFACTURER'S DATA:**

DINI ARGEO srl – via della Fisica , 20 - 41042 Spezzano di Fiorano (MO) - Italy

Tel. 0536-843418 Fax 0536-843521 E-mail [info@diniargo.com](mailto:info@diniargo.com) web [www.diniargo.com](http://www.diniargo.com)

#### **1.1.2 Premises**

The purpose of this manual is for the user to know all the fundamental norms and criteria for the installation, the correct use and for carrying out the correct maintenance of the purchased instrument.

Therefore:

- This manual contains all the scale's user instructions and the necessary knowledge for its correct and safe use.
- This manual supplies the useful indications for the correct functioning and maintenance of the relative electronic crane scale; it is therefore important to pay careful attention and refer to all those sections which illustrate the simplest and safest way to operate.
- This publication, or any part of it, can be reproduced without the written authorisation by the Manufacturer.

**PS: The person responsible for the use of the weight indicator must make sure that all of the safety rules in force in the country of its use should be applied, to guarantee that the equipment is used in conformity with the use for which it is destined and avoid any dangerous situation for the users.**

Any attempt of tampering or modifying the instrument by the user or non authorised personnel, or improper use, or different than what is foreseen in this manual, will relieve the Manufacturer from all responsibility in the case of damages caused by people or things.

### 1.1.3 Symbols

Please find below the symbols in the manual which recall the operator's attention, in regards to the various danger levels. The danger levels will be subdivided in four classes of importance:



**DANGER!!**



Concept or procedure which, if not carried out accurately, causes the danger or harsh personal injuries in case of accident.



**CAREFUL!!**



Concept or procedure which, if not carried out accurately, can cause harsh personal injuries or damages to the instrument in case of accident.



**CAUTION!!**



In case of an accident, concept or procedure which can cause damages to the instrument or materials or adjacent to it, if it does not carry out accurately.



**WARNING:** Important information or procedure which advises the operator regarding the optimal use of the system and on all the connected work modes.

Besides the symbols of the four different danger levels, other symbols used, will be shown:

- in the manual to recall the attention of the reader;
- on the instrument to recall the attention of the user.



Conforms to the standards of the European Union.



Identifies the Class Of Precision defined by the OIML to represent 3000 divisions

**“TECH.MAN.REF.”**

means that an advanced function is being described (therefore for the technical personnel) which will be further explained in the corresponding technical manual.



The crossed-out wheeled bin on the product means that at the product end of life, it must be taken to separate collection or to the reseller when a new equivalent type of equipment is purchased. The adequate differentiated refuse collection in having the product recycled helps to avoid possible negative effects on the environment and health and supports the recycling of the materials of which the equipment is made. The unlawful disposal of the product by the user will entail fines foreseen by the current regulations.



It is forbidden to halt or transit under suspended load.

### 1.1.4 General precepts

The warnings shown in this manual recall the ATTENTION OF THE OPERATOR in regards to information or procedures which advise the best use of the equipment in order to:

- work safely;
- lengthen the duration and functionality;
- avoid the damages or loss of the programming;
- optimise the work by taking into account the metric and safety norms in force in the country where it is used;



The crane scale is to be considered a scale, and therefore should only be used as a weighing instrument. Therefore any improper use, or different than what is foreseen in this manual, will relieve the Manufacturer of all responsibilities in case of damages, direct or indirect, caused to people or things.

For the indications and warnings for working in safety conditions see the “GENERAL SAFETY NORMS” section.

### 1.1.5 Destination of use

The “MCW/MCWK” instrument is a non automatic weighing device, to be considered as a lifting accessory, suitable to be used on cranes, or on similar lifting devices.

In regards to the weight measurement it is possible to identify the following operating conditions:

- use for determining the weight for commercial transactions.
- use for determining the weight for internal use.

The name of the device models suitable to be used for commercial transactions are distinguished by a final letter M and APPROPRIATE MARKINGS (see section “MARKINGS”).

The device can be used only in ordinary work environments. For further details see section “ENVIRONMENTAL CONDITIONS”.

## 1.1.6 Typical CE conformity declaration



**DICHIARAZIONE DI CONFORMITA'  
DECLARATION OF CONFORMITY  
KONFORMITÄTSERKLÄRUNG  
DÉCLARATION DE CONFORMITÉ  
DECLARACIÓN DE CONFORMIDAD**

Fabbricante: Manufacturer: Hersteller: Fabricant: Fabricante:	DINI ARGEO srl
Dinamometro elettronico modello: Electronic crane scale model: Electronische Kranwaage Modell: Dynamomètre électronique modèle: Gancho pesador electrónico modelo:	MCW / MCWR2/MCWK
Anno di costruzione: Manufacturing year: Herstellungsjahr: Année de fabrication: Año de construcción:	
Numero di serie: Serial number: Seriennummer: Numéro de série: Número de serie:	

E' conforme alle direttive:

-Conforms to the directives: / Konform mit folgenden richtlinien ist: / Est conforme aux directives: / Es conforme a las directivas:

**2004/108/CE - Compatibilità Elettromagnetica**

-Electromagnetic Compatibility / Elektromagnetische Kompatibilität /

**-Con riferimento alle norme armonizzate:**

-With reference to these harmonised norms: / Mit Bezug auf die Normen: / En référence aux normes harmonisées: / Con referencia a las normas armonizadas:

**(CEI EN 61000-6-2 / 2006 ; CEI EN 61000-6-4 / 2007 ; CEI EN 61326-1 / 2007 ; CEI EN 55011 / 2009)**

**2006/42/CE - Macchine**

-Machines / Maschinen / Machines / Máquinas

**Dichiara inoltre che:**

Declares also that: / Der Hersteller erklärt außerdem, dass: / Déclare également que: / Declara también que:

**-La persona autorizzata a costituire il fascicolo tecnico presso la sede del fabbricante è la Direzione Tecnica.**

The person authorised to compose the technical file at the premises of the manufacturer is the Technical Management. /

Die autorisierte Person, die die technischen Dokumente im Firmensitz des Herstellers verwaltet, ist das technische

Management. / La personne autorisée à constituer le dossier technique chez la siège du fabricant est le directeur

technique. / La persona autorizada a constituir el expediente técnico en la sede del fabricante es la Dirección Técnica.

Data/Date/Datum	Firma/Signature/Unterschrift
-----------------	------------------------------

**1.1.7 Markings**

On the equipment one will find a label in which there are shown the metrological and technical information as well as the relative CE marking of the instrument.



For no reason the data or closing and legalisation seals on the instrument's plate, must be modified or removed. In case of tampering or removal of this information, the warranty of the instrument ceases, and the manufacturing company is released from any eventual damage, direct or indirect, caused to people or to things.  
**THE LABELS ARE OF THE ADHESIVE TYPE, WHICH DETACH THEMSELVES WHEN DESTROYED.**


Marking for devices suitable for internal use:



In which:

- 1 Company name and fabrication status
- 2 Name of the machine
- 3 Name of the machine model and the type of installed electronic device
- 4 Serial Number (sn)
- 5 CE Markings
- 6 Power supply voltage
- 7 Symbol of the dumpster: indicates that at the end of its useful life the product must be disposed in the appropriate waste collection bins
- 8 Instrument's precision class
- 9 Measuring field:  
 Max= maximum capacity or full range of the instrument;  
 Min= minimum weigh. Weighing accuracy is not guaranteed below this value;  
 e= division value
- 10 Space reserved for the CE type approval certificate number
- 11 Building year of the machine

Markings for devices suitable for commercial transactions:


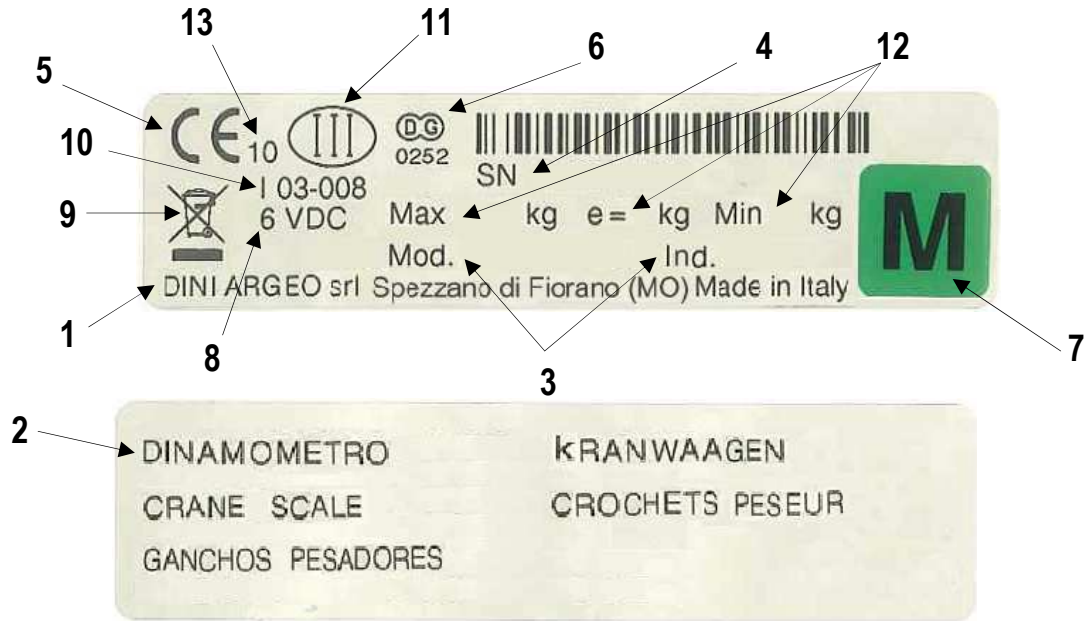


In which:

- 1 Company name and fabrication status
- 2 Name of the machine
- 3 Name of the machine model and the type of installed electronic device
- 4 Serial Number (sn)
- 5 CE Markings
- 6 Space reserved for the number of the notified body
- 7 Conformity marking (instrument subject to metrological check)
- 8 Power supply voltage
- 9 Symbol of the dumpster: indicates that at the end of its useful life the product must be disposed in the appropriate waste collection bins
- 10 Space reserved for the CE type approval certificate number
- 11 Instrument's precision class
- 12 Measuring field:
  - Max= maximum capacity or full range of the instrument;
  - Min= minimum weigh. Weighing accuracy is not guaranteed below this value;
  - e= division value
- 13 Building year of the machine



Markings on the load cell:

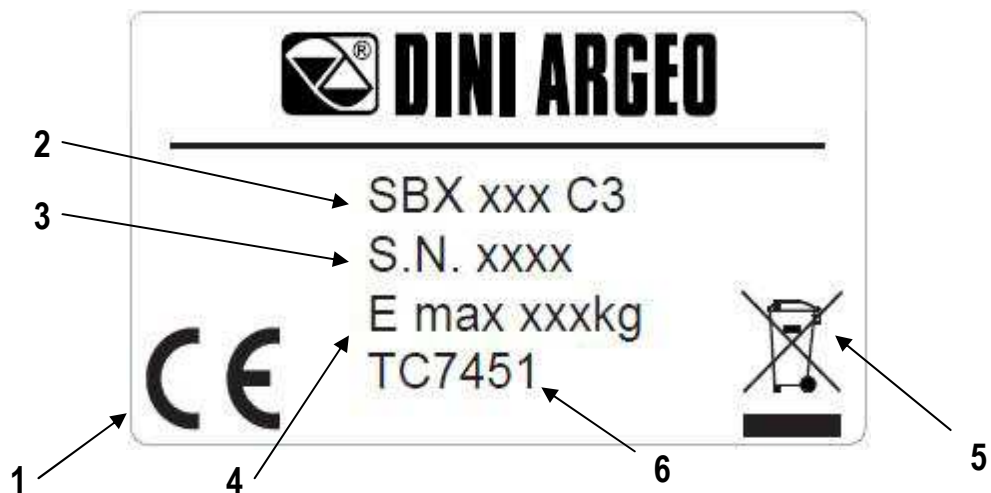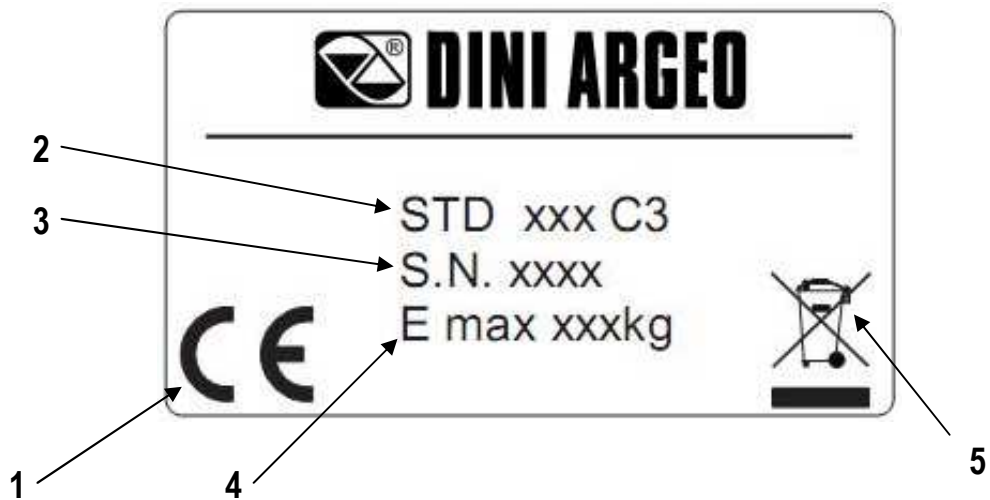

SBX model available only for crane scales with capacity below 1500 kg (MCW150R2, MCW150MR2, MCW300R2, MCW300MR2, MCW600MR2, MCW600R2, MCW1500R2 and MCW1500MR2).

In which:

- 1 CE marking
- 2 Name of the series or model of the load cell
- 3 Serial number (sn)
- 4 Maximum useful load (maximum capacity)
- 5 With the issuing of the July 22nd, 2005 nr. 151 decree-law, relative to the European Directive 2002/96/EC in regards to the Waste Electrical and Electronic Equipment (known as WEEE), the relative manufacturers are called to intervene and manage the life cycle end of their introduced products. All the WEEE products must have impressed an easily visible and undeletable crossed-out dumpster. Therefore the manufacturers must offer all the instruments necessary for a correct disposal of this equipment.
- 6 Test Certificate issued by OIML Notified Body.

### **1.1.8 Periodic metrological verification**

For all weighing instruments used in commercial transactions, it must be ascertained that the metrological features and the measurement reliability are kept in time. A periodic metrological verification is, therefore compulsory; the periodicity and the verifying person depend on the laws / regulations of the country in which one is operating.

### **1.1.9 Directives and reference norms**

List of the EC directives taken into reference:

- 2009/23/EC (Non automatic weighing instruments)
- 2004/108/EC (Electromagnetic compatibility)
- 2006/95/EC (Low Voltage)
- 2006/42/EC (Machines)
- 1999/5/EC (Radio equipment); only version with radio module
- 2002/95/EC ; 2003/118/EC ; 2002/96/EC ( RoHS and WEEE )

List of norms or other documents taken into reference:


- FEM1.001
- CEI EN 61000-6-2 / 2006
- CEI EN 61000-6-4 / 2007
- CEI EN 61326-1 / 2007
- CEI EN 55011 / 2009
- 1999/519/EC recommendation (only version with radio module)
- ETSI EN 301489-3 1.4.1 version (only version with radio module)
- ETSI EN 300220-2 2.1.1 version (only version with radio module)

## 1.2 TECHNICAL FEATURES OF THE WEIGHING SYSTEM


### 1.2.1 Main components

The “MCW/MCWK” instrument is an electronic weighing device. In order to better understand this product, please find below the main components which are part of this machinery.


#### MCW PROFESSIONAL:

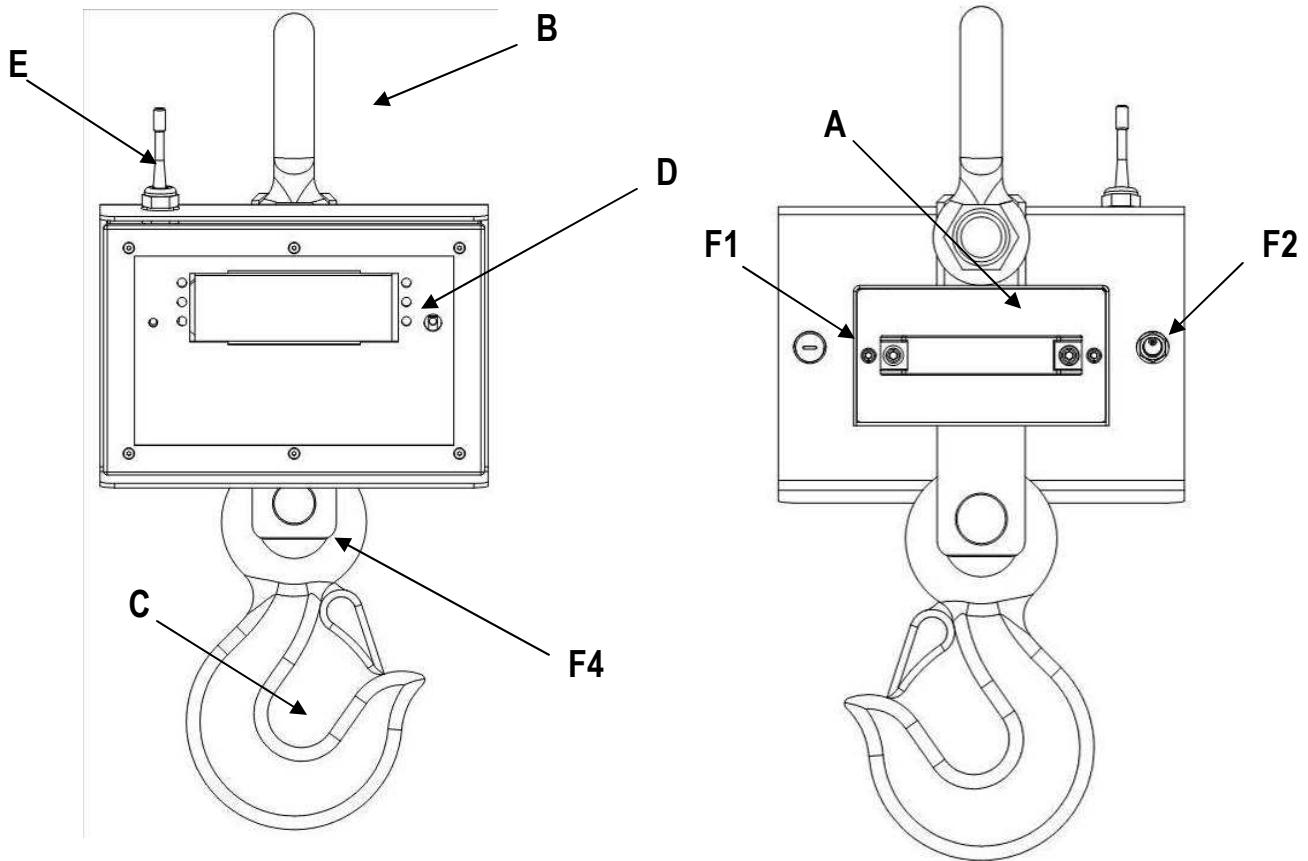

#### MCWR2 PROFESSIONAL (INOX VERSION):

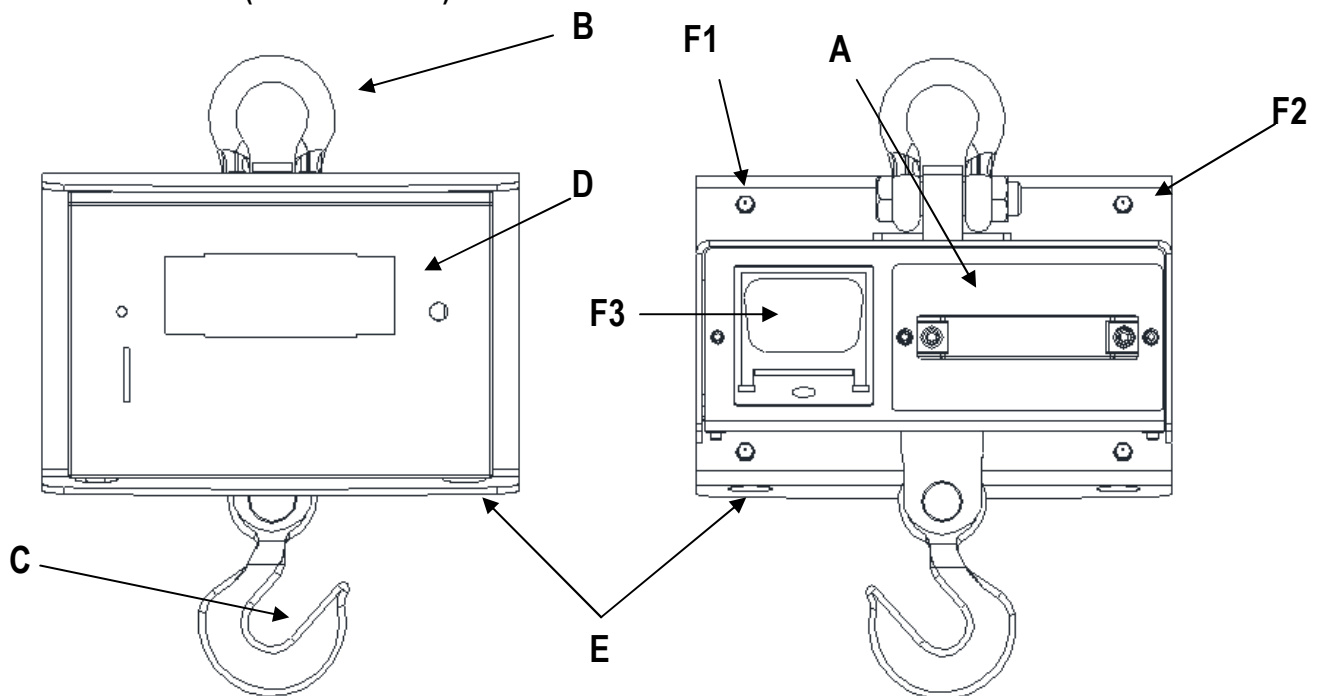


#### MCWK PROFESSIONAL IN ACCIAIO INOX

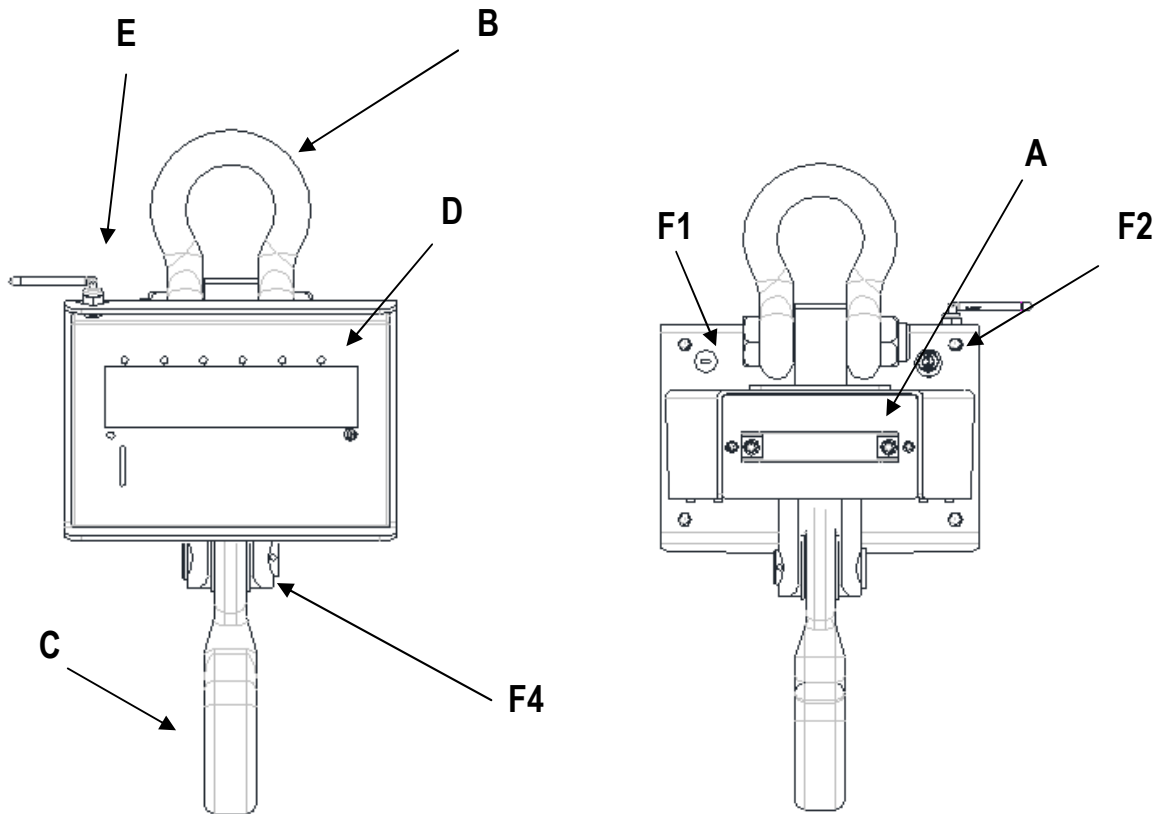

- A:** body in which there is the tension load cell;
- B:** shackle for connection between the lifting device hook and the load cell;
- C:** eye hook to connect the swivel body to the lifting devices;
- D:** electronic device for converting the signal coming from the transducer into a weight unit, with measurement display, and command and adjustment systems;
- E:** hole predisposed for the outlet of the antenna (the version with radio module);
- F1:** hole prepared for RS232 serial connection to any external devices (hole is protected by a stainless steel cap screw threaded);
- F2:** Connector for connecting to external power supply through "jack";
- F3:** Integrated thermal printer, upon request (only for the "MCWR2").
- F4:** Centering washers for the lower hook (only for the MCWK8, MCW3000 and MCWT6 models). These are essential for the correct functioning of the crane scales; without these washers, the lower hook will not maintain the central position and the instrument will show an incorrect weight.

In MCW/MCWK electric crane scale, power is supplied by a rechargeable 6 V- 4,5 Ah to be inserted into the battery box located on the back of the equipment.

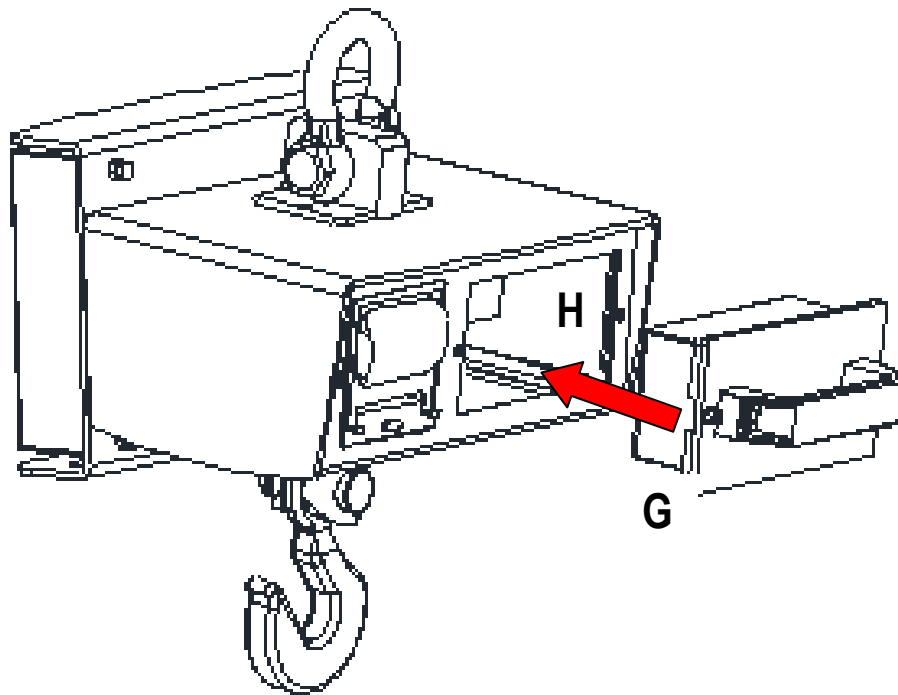


**G:** Are the battery box and the relative way of insertion in the electronic crane scale MCW.

**H:** is the insertion slot in which you insert the battery box. The slot is located on the back of the instrument.

For more information concerning the battery and its features, see paragraph "ELECTRONIC CRANE SCALE BATTERY: INSTRUCTIONS AND RECHARGE".

1.2.2 Crane scale dimensions


MCW PROFESSIONAL:

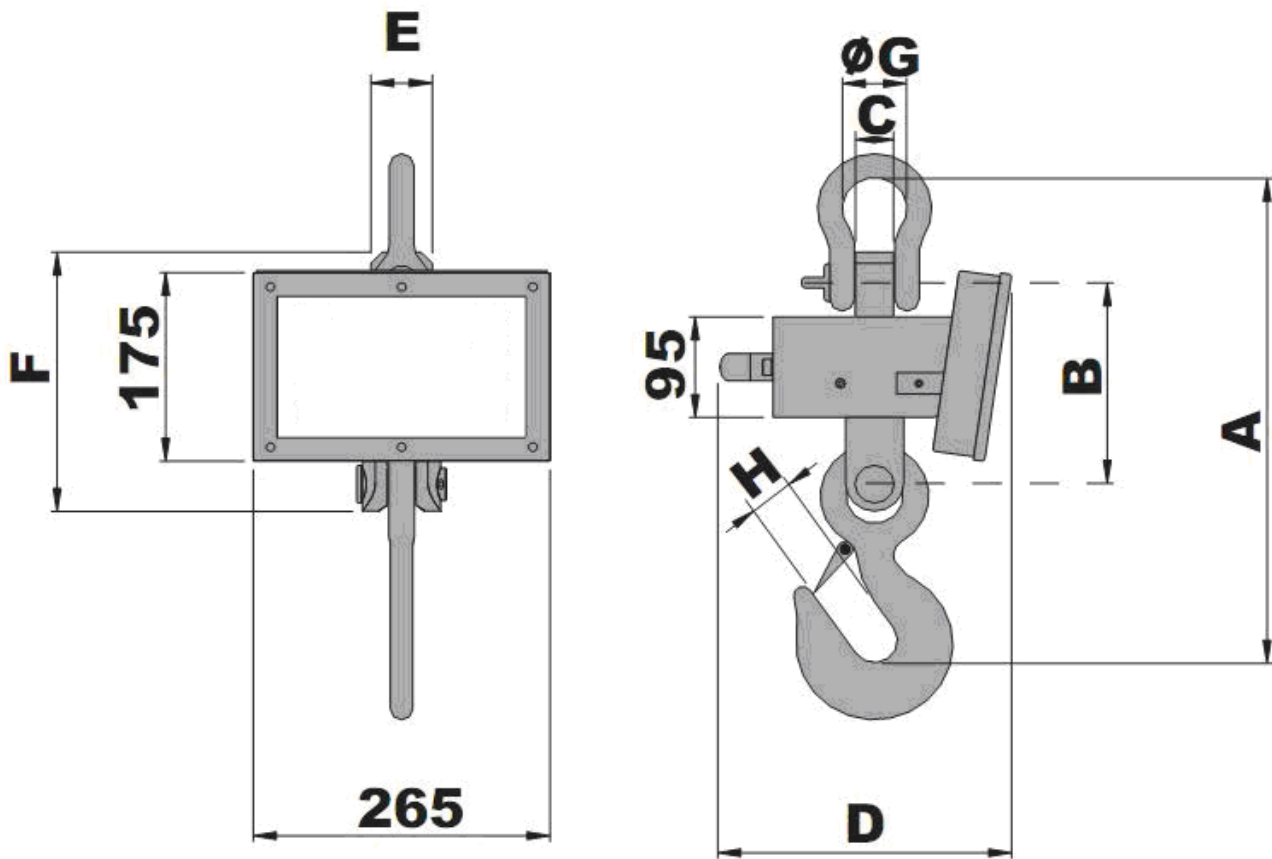

DIMENSIONS EXPRESSED IN mm

MODEL	A	B	C	D	E	F	G	H
MCW3000	450	187	34	260	55	240	58	38
MCW6T	450	187	34	260	55	240	58	45


**MCWR2 PROFESSIONAL (INOX VERSION):**

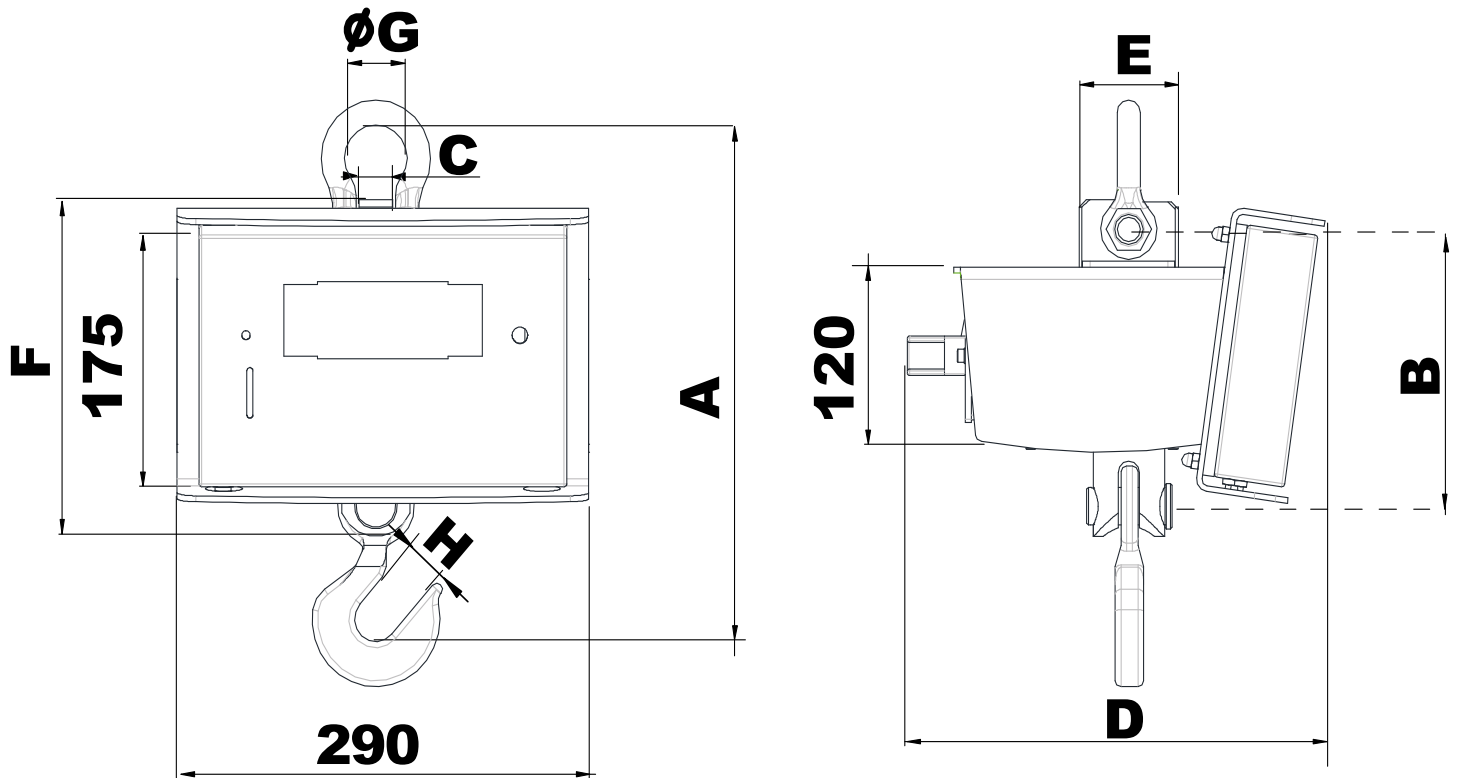

**DIMENSIONS EXPRESSED IN mm**

MODEL	A	B	C	D	E	F	G	H
<b>MCW150R2</b>	340	180	24	290	70	224	43	30
<b>MCW300R2</b>	340	180	24	290	70	224	43	30
<b>MCW600R2</b>	340	180	24	290	70	224	43	30
<b>MCW1500R2</b>	340	180	24	290	70	224	43	30

**MCWK PROFESSIONAL(VERSIONE INOX):**

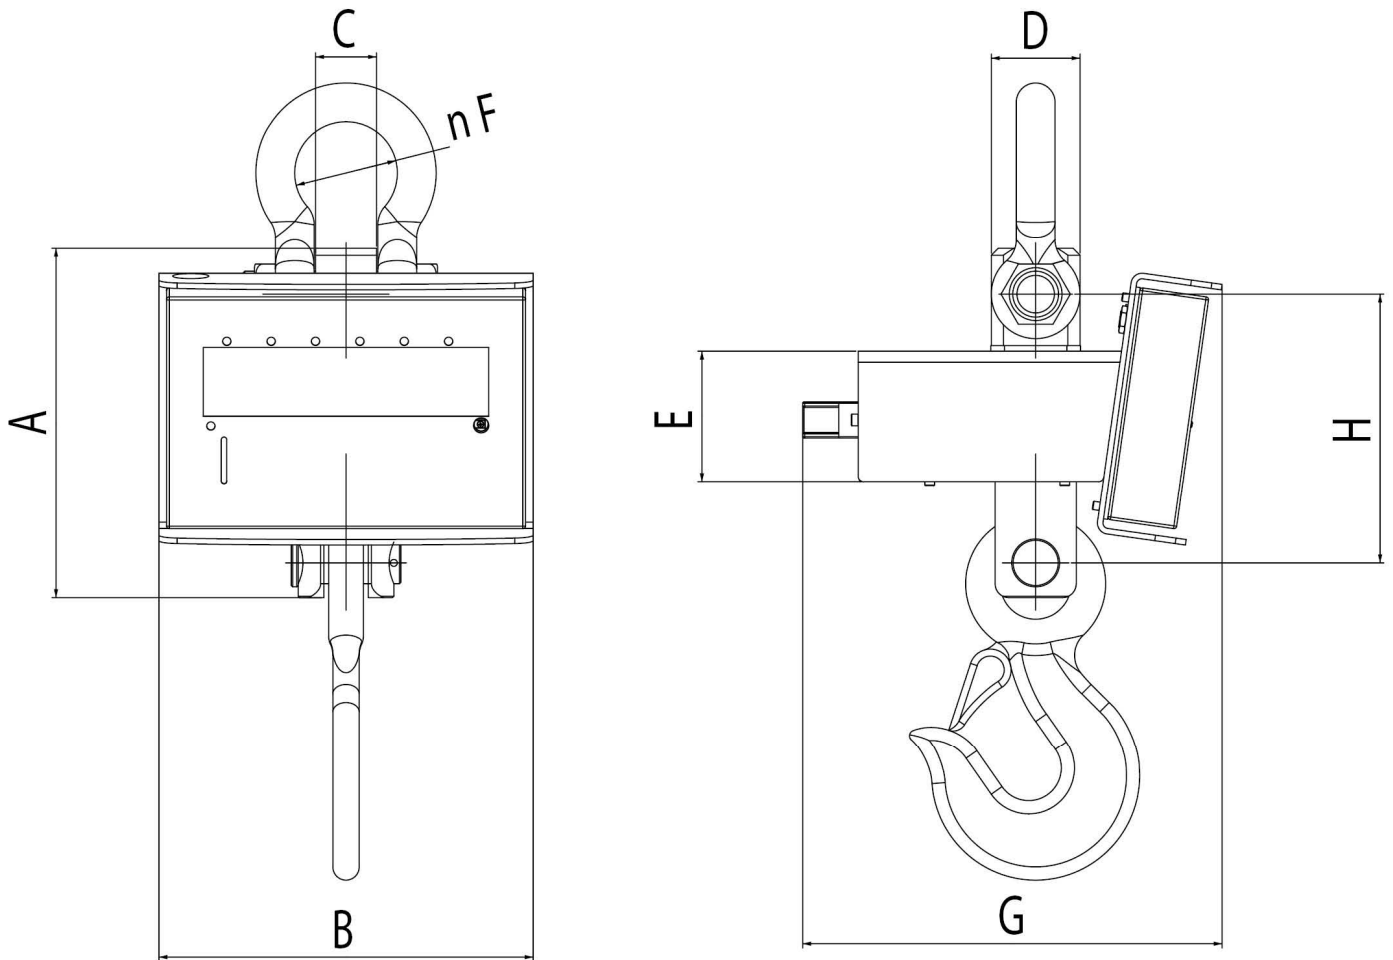

**DIMENSIONI ESPRESSE IN mm**


MODELLO	A	B	C	D	E	F	G	H
MCWK	250	270	44	64	94	74	302	194



**1.2.3 Size of shackles and hooks**

The electronic crane scale "MCW" comes with 1 shackle and 1 eye hook. The accessories supplied have the following characteristics.


**SAFETY PIN SHACKLE**

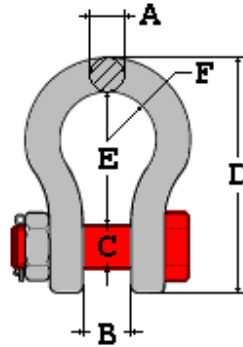

MODEL	CAPACITY [Tons]	A [mm]	A [inch]	B [mm]	C [mm]	D [mm]	E [mm]	F [mm]	c.s	WEIGHT [kg]
MCW150R2	3,25	16,5	5/8	27,5	20	106	60	22	6	0,75
MCW300R2	3,25	16,5	5/8	27,5	20	106	60	22	6	0,75
MCW600R2	3,25	16,5	5/8	27,5	20	106	60	22	6	0,75
MCW1500R2	3,25	16,5	5/8	27,5	20	106	60	22	6	0,75
MCW3000	3,25	16,5	5/8	27,5	20	106	60	22	6	0,75
MCWT6	6,5	22	7/8	37	25	146	84,5	29	6	1,87
MCWK6	6,5	22	7/8	37	25	146	84,5	29	6	1,87
MCWK8	9,5	28	1"1/8	46	33	185	108	37	6	3,58

MATERIAL  
PIN  
EYE HOOK

Bonified 6-degree highly resistant steel  
RAL 3001 red pin with metric threading

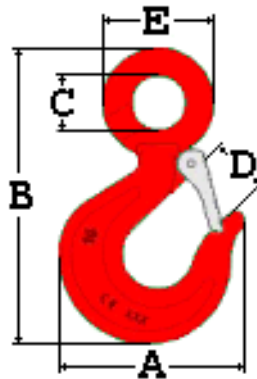

MODEL	CAPACITY [Tons]	A [mm]	B [mm]	C [mm]	D [mm]	E [mm]	WEIGHT [kg]
MCW150R2	3,20	103	163	32	33	62	0,91
MCW300R2	3,20	103	163	32	33	62	0,91
MCW600R2	3,20	103	163	32	33	62	0,91
MCW1500R2	3,20	103	163	32	33	62	0,91
MCW3000	3,20	103	163	32	33	62	0,91
MCWT6	8	166	264	51	47	101	3,95
MCWK6	8	166	264	51	41	101	3,95
MCWK8	8	166	264	51	41	101	3,95

MATERIAL  
FINISH

Hardened alloy steel.  
Raw or red painted.

**1.2.4 Electronic device features**

PROTECTION DEGREE	IP 67
POWER SUPPLY	6 Vdc – 4,5 Ah rechargeable internal battery, standard, range of about 60 hours. 12 Vdc with external power supply 100 ÷ 240 Vac (50÷60 Hz)/12 Vdc standard.
MAXIMUM POWER	5 VA.
MINIMUM VOLTAGE PER DIVISION	0.3 $\mu$ V (Homologated instrument); 0.03 $\mu$ V (non homologated instrument).
DISPLAYED DIVISIONS	10000e, 3X3000e for legal for trade use expandable to 800.000 for internal factory use (with <b>minimum</b> signal coming from the 1,6mV/V cell).
DISPLAY	MCW - Backlit 25 mm LCD display with 6 digits. MCWK - 40 mm LED display with 6 digits.
RESOLUTION IN COMTAGAGE	1'500'000 points (with input signal equal to 3mV/V).
KEYBOARD	Water resistant key polycarbonate membrane with tactile feedback.
TARE FUNCTION	Subtractive on the entire capacity.
AUTO POWER OFF	Adjustable from 1 to 255 minutes of no use, disinsertable.
LOW BATTERY WARNING	"Low bat" shown on the display.
MEASUREMENT UNIT AVAILABLE	g= grams, kg= kilograms, t= tons, Lb= pounds.
IN CALIBRATION PHASE CONTAINER	Sturdy stainless steel, against dust and splashes.
POWER OF LOAD CELLS	5Vdc $\pm$ 5%, 120mA (max 8 load cells 350 Ohm).
I/O SECTION	- 1 RS232/TTL input/output - 1 RS232/input/output Configurable for connection to PC/PLC, WEIGHT REPEATER or. PRINTER.
THEORETICAL LIFE	If the instrument is regularly maintained and if the user instructions shown in this manual are carried out, the instrument will attain a theoretical life of 5 years; the data is a function of use is subject to change according to audits by the manufacturer. For further details, see section "MAINTENANCE AND VERIFICATIONS".

**THE PARTS OF THE INSTRUMENT CONTAINING DANGEROUS ELECTRICAL TENSION ARE ISOLATED AND INACCESSIBLE TO THE USER UNLESS IT HAS BEEN DAMAGED, OPENED, OR ALTERED.**

### 1.2.5 Load cell features

The load cell is of the strain gauge type, with temperature compensation.

The main technical features are:

- *Precision and repeatability conform to the OIML R60 recommendation.*
- *Precision: 0,8% of the Full Scale capacity (F.S.).*
- *High precision and repeatability.*
- *Maximum number of load cell divisions:  $nLC = 3000$ .*
- *Sensitivity:  $2mV/V \pm 10\%$ .*
- *1000 Ohm input resistance.*
- *1000 Ohm output resistance.*
- *Nominal load creep after 4 hours: 0,03% full range.*
- *Thermal compensation:  $-10^{\circ}C / +40^{\circ}C$ .*
- *Foreseen life: if the cell is not subject to knocks and/or overloads and is regularly submitted to maintenance, will attain a theoretical life from 3 to 5 years.*

### 1.2.6 Indicator environmental features

Environmental operating features:

OPERATING TEMPERATURE	From -10 to +40°C.
RELATIVE HUMIDITY	From 10 to 85 % without condensation

**1.2.7 Remote control: keys and commands**

Along with the “MCW” electronic crane scale, an infrared remote control is supplied in which it is possible to repeat the keyboard functions. Optionally is possible to have a 6-key radio remote control.

The type of remote control to be used must be selected in the Setup environment, in the << ir.ConF >> step.

**NOTE: The infrared remote controls are for indoor use only.**



**CAUTION!!**



Do not press the keys with hard and/or pointed objects; only use fingers.

The functioning instructions are described in section “FUNCTIONING WITH REMOTE CONTROL”.

**1.2.8 Radio module features (only for model with radio module)**

The radio module version allows communicating in radio frequency with eventual external devices (PC, printer or weight repeater); it is fitted with two multipoint radio frequency modules; one is installed on the measurement device and the other on the remote unit. The remote modules can be inserted inside the devices, or fitted with their own watertight containment box and connected by cable.

The multi channel radio module functions in a frequency band, without need of license.

**SPECIFICATIONS:**

POWER SUPPLY	5-12Vdc 100mA max
OPERATING TEMPERATURE	From -10 to +40 °C.
TIMING	Power Up Sequence: 135 ms Enter in Serial Stand-by: 3.2 ms Wake Up from Serial Stand-by: 5.5ms
MAXIMUM POWER	25mW
WORK FREQUENCY	From 868 to 870 MHz
NUMBER OF CHANNELS	Up to 52
RADIO TRANSMISSION SPEED	Up to 38.4 kbps
SERIAL TRANSMISSION SPEED	Up to 19.2 kbps
INPUT/OUTPUT 1 RS232 PORT USB	on AMP connector or 1 USB port (with a 1m long cable fitted), depending on the model.
FUNCTIONING DISTANCE, IN APPROPRIATE CONDITIONS	Up to 70m indoors, up to 150m outdoors
CONTAINER	Box in PVC (depending on the model)
ANTENNA	Swivelling and inclinable

**NOTE:**

**For details regarding the configurations and use of the radio module contact the Dini Argeo Assistance Centre. The device manual can be downloaded from the [www.diniargeo.com](http://www.diniargeo.com) internet web site or requested to the Assistance Centre.**

## 1.3 GENERAL SAFETY NORMS

The user must respect the manufacturer's prescriptions of the crane scale; one must respect the prescriptions requested by the manufacturer of the lifting device, and those highlighted in the eventual safety data sheet of the product which must be weighed.

### 1.3.1 Laws and national norms

Before putting into service and while using it, the user must ascertain that all norms in force in the country, where the instrument is used in regards to "safety and prevention of casualties" and "metrology", are respected.

It is also important to take into account and respect the laws and prescriptions of the Bodies assigned to the safety control of the country of use.

### 1.3.2 General warnings

- DO NOT exceed the nominal capacity of the crane, of the scale or of any support element of the load fixed onto the scale.
- Use the scale EXCLUSIVELY for the lifting and the weigh of suspended loads and for TENSION measurements.
- Suspended loads which may cause applied torsion stresses MUST be hanged with flexible or swivelling bindings.
- Carefully respect all the safety measurements established by the manufacturer of the electronic crane scale, which are shown in the instruction manual.
- It is severely forbidden to exceed the nominal capacity of the crane, the scale, or any support element of the load that is fixed onto the scale.
- The electronic crane scale is to be considered a scale, and therefore should only be used as a weighing instrument. Therefore any improper use or use that is different than what is foreseen, will relieve the Manufacturer from all responsibilities in case of damages caused to people or things.
- Entrust the installation, set-up, maintenance, operations only to specialised personnel.



The crane scale is to be considered like an actual scale, and therefore it must be used only as a weighing instrument. Therefore, an improper or different use than what is foreseen in this manual, will release the Manufacturer from all responsibilities in case of damages caused to people or things.

### 1.3.3 Organisational measures of the user company

- Respect the safety measures established by the manufacturer of the electronic crane scale, the manufacturer of the lifting device, and eventually of the safety board of the product to be weighed.
- The electronic crane scale must be used only for the foreseen purposes.
- Entrust the use of the instrument only to expert and trained people, also with experience in using the lifting equipment.
- Entrust the execution of installation, putting into function, maintenance, and repair operations only to specialised personnel (section "MAINTENANCE AND VERIFICATIONS").
- Make sure that the user manual is always available where the scale is used.
- Carefully read and apply what described in the section "POWER SUPPLY – START-UP – SWITCH-OFF".
- The nominal capacity of the scale must be equal or greater than the crane. If the nominal capacity of the scale is greater than the maximum capacity of the crane, make sure that loads, which are greater than the maximum capacity of the crane or of any support element of the load, are lifted.
- Use only original spare parts.
- All the indicator connections must be made respecting the norms applied in the installation zone and environment.
- Periodic verification with registry.
- The electronic crane scale must be submitted to regular maintenance and repair interventions (see section "MAINTENANCE AND VERIFICATIONS").
- File the test result and conserve it in the test register.
- When one notices anomalies while using the electronic crane scale, IMMEDIATELY stop all operations and do not reuse the instrument until the instrument has been submitted to specific controls by specialised and authorised personnel or by Dini Argeo service assistance personnel.



Incorrect use, but reasonably foreseeable, by untrained people entails a non acceptable residual risk.

### 1.3.4 Indications and warnings regarding the crane scale

- It is strictly FORBIDDEN for non authorised personnel to enter in the operating zone.
- It is strictly FORBIDDEN to walk or halt below or near suspended loads.
- It is strictly FORBIDDEN to exceed the nominal capacity of the crane, the scale or of any load support element fixed to the scale.
- It is strictly FORBIDDEN to lift loads exceeding the maximum capacity of the MCW, which is shown on the sides of the instrument.
- The crane scale is to be considered a scale, for all purposes, and therefore should only be used as a weighing instrument.
- Use the scale EXCLUSIVELY for lifting and weighing the suspended loads and for TENSION measurements.
- Place the crane so that the load is lifted vertically.
- Place the load without causing knocks using a low speed of the crane.
- Once the load harnessing operation is done, move away, and make sure that the load is well balanced lifting it up a few centimetres from the ground.
- Use structures with single hitch elements which allow a correct alignment of the scale.
- Do not use structures with single hitch large-sized elements which could block the correct alignment near the hitch point.
- Suspended loads which can cause applied torsion stresses MUST be hanged with flexible or swivelling bindings.
- It is FORBIDDEN to make oblique moves on the load.
- Carefully read and apply what described in section "POWER SUPPLY – START-UP – SWITCH-OFF".
- Periodically check the integrity of all the scale parts (see section "MAINTENANCE AND VERIFICATIONS").
- Any maintenance, repair, or cleaning operations must be made with the electronic crane scale turned off (see section "MAINTENANCE AND VERIFICATIONS").
- Use the DPI prescribed by the manufacturer of the lifting system and eventually those highlighted in the safety data sheet of the weighing article (helmet, accident-prevention shoes, etc.).



**DANGER!!**



The nominal capacity of the electronic crane scale must not be lower than the maximum capacity of the lifting device. If one attaches a crane scale with a nominal capacity less than the nominal capacity of the lifting device, verify it with another weighing system, making sure that the load to be weighed is not greater than the nominal capacity of the electronic crane scale.

### 1.3.5 Indications and bans for working in safe conditions

- It is FORBIDDEN to use the equipment for lifting or transporting people.
- It is FORBIDDEN to pull or drag loads, but only to apply vertical forces.
- DO NOT exceed the rated capacity of the crane, scale or any bearing element attached to the scale.
- DO NOT swing the load by pushing it or putting it beyond the work area of the lifting device.
- DO NOT use multiple attachment points.
- DO NOT push nor pull the load or the loaded scale.
- DO NOT pull the hook from the side.
- It is FORBIDDEN to use the device for weighing radioactive materials or melted masses.
- DO NOT stretch obliquely the load.
- It is FORBIDDEN to make any changes to the scale.
- DO NOT spill liquid on the instrument.
- DO NOT use solvents or industrial chemicals for cleaning the instrument

### 1.3.6 Environmental conditions

- DO NOT install in an area with risk of explosion.
- DO NOT expose the instrument to direct sunlight or near sources of heat.
- DO NOT expose the instrument to strong magnetic or electrical fields.
- DO NOT install the instrument in an environment at risk of corrosion.
- It is FORBIDDEN to use the device beyond the temperature range from  $-10^{\circ}\text{C}$  to  $+40^{\circ}\text{C}$ .
- It is FORBIDDEN to use the device outdoors or in very humid environments.
- Protect the electronic crane scale from the high humidity, vapours, liquids or powders. If the electronic crane scale is installed in a much warmer environment than it was before, it can form an undesired condensation (condensation of humid air on the device). In this case, turn off the electronic crane scale and wait until it adapts to the temperature of the environment (approximately 2 hours).



## 2 USER MANUAL

### 2.1 USER

#### 2.1.1 Professional features

The staff assigned to the electronic crane scale and all activities related to it must:

- Have appropriate physical and mental characteristics;
- Be an expert or have sufficient knowledge on lifting equipment and be trained in the proper use of scales;
- Be familiar with the requirements of labour protection and accident prevention in the field;
- Be able to evaluate the safety condition of the lifting equipment;
- Understand the safety signs on the machine, the warnings and the messages highlighted in the manual of the instrument,  
even if he does not have a good command of the language in which the crane operates;
- Be able to make oneself understood in the workplace.

#### 2.1.2 Location

The operator of lifting equipment, which was installed on the crane scale, must not only respect the safety conditions but is also responsible for accidents that may occur around the machine.

Therefore, the operator must place himself in a working position which is safe for people, things, and vehicles in the workplace. In particular, the operator must:

- Be very careful to never position below the load or in positions which could be dangerous if there was a rupture of an accessory of lifting equipment;
- Always have a good visibility of the load and eventual personnel nearby;
- Evacuate the people and things from the work area;

#### 2.1.3 Clothing and equipment

The personnel must wear clothing and be fitted with personal protective equipment required for the lifting vehicle used (helmets, protective gloves, safety shoes, etc..).

## 2.2 DESCRIPTION OF THE MACHINES AND CONTROLS

### 2.2.1 Power supply – Start-up – Switch-off

The instrument is powered by a 6 VDC internal rechargeable battery.

It is possible to charge the battery through the 12V power adapter (supplied) which should be connected to the 230 Vac mains voltage.

Safety norms must be respected for the connection to the mains voltage including the use of a line which has to be free from noise generated by other electronic equipment.

**NOTE: It is advisable to completely recharge the battery (12 hours) in the first installation of the instrument; we RECOMMEND disconnecting the battery if the instrument is not going to be used for more than 30 days.**

### BATTERY CHARACTERISTICS

Material	LEAD
Power	4,5 Ah
Output	6 V

**THE BATTERY MUST ONLY BE REPLACED WITH AN ORIGINAL FROM THE MANUFACTURER.**

In order **TO CHARGE THE BATTERY** through the 230Vac mains, one should insert the plug end of the AC/DC power adapter into the socket in the back of the instrument and the adapter to your 230Vac current source (the **power-on** led on the front panel turns on).

**Do not connect other equipment to the same socket as the one that the adapter is in.**

**Do not step on or crush the power supply cable**

**TO TURN ON** the instrument press the C key until the indicator turns on; then release.

The display shows in sequence:

**XX.YY** is the installed software version.

**bt XXX** in which XXX is a number from 0 to 100 which indicates the battery level.

The indicator has an “auto zero at start-up” function: in other words it means that if at start-up a weight within +/- 10% of the capacity is detected, it will be zeroed; if the weight is not within this tolerance, with a non approved instrument the display shows the present weight after a few instants, while with an approved instrument “ZEro” is shown continuously on the display, until the weight does not re-enter within this tolerance; the auto zero function at start-up may be disabled in the set-up environment (only with non approved instrument); see **SEtuP >> ConFiG >> PArAM. >> Auto-0** parameter (**TECH.MAN.REF.**).

By pressing the **ZERO** key for an instant while the version is shown in the display, the indicator will show the following in this order:

**CLoCk** if there is the optional board with date and time.

**XX.YY** in which XX indicates the instrument type, YY indicates the metrological software version.

**XX.YY.ZZ** is the installed software version.

**XXXXXX** is the name of the installed software.

**bt XXX** in which XXX is a number from 0 to 100 which indicates the battery level.


**-K- X.YY** in which K identifies the type of keyboard: K=0 5-key keyboard, K=1 17-key keyboard.  
X.YY is the installed software version.

After this, “hi rES” is displayed (in case of non approved instrument) or “LEGAL” and the g gravity value (in case of approved instrument), then the programmed capacity and minimum division, and finally it executes a countdown (self-check).

**TO TURN OFF** the instrument keep the **C** key pressed until the “- OFF -” message appears on the display; then release the key.

### 2.2.2 Front panel keys and indicators

The front panel is projected in order to make easy and immediate use of the indicator by the user; it consists of a display to 6 digits 25mm high, a film waterproof keyboard with 5 keys. During the weighing, different symbols indicating the status of multifunction operation are also activated (see section "SYMBOLS ON THE LCD DISPLAY").

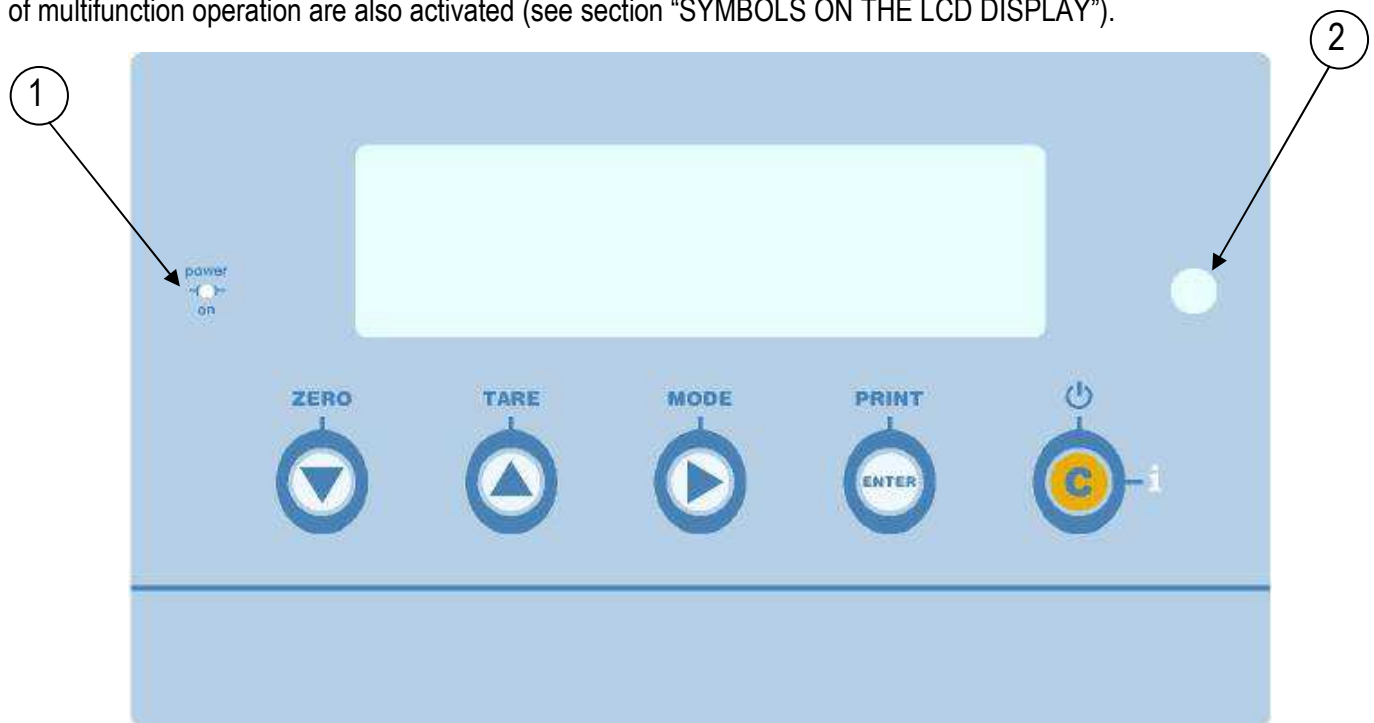


① Indicates the presence of power supply.

② Sensor for the reception of the infrared signal.

### 2.2.3 Front panel keys and indicators

The front panel is projected in order to make easy and immediate use of the indicator by the user; it consists of a display 6 DOT LED 40mm high digits, 7-LED indicators and a waterproof film keypad at 5 keys.

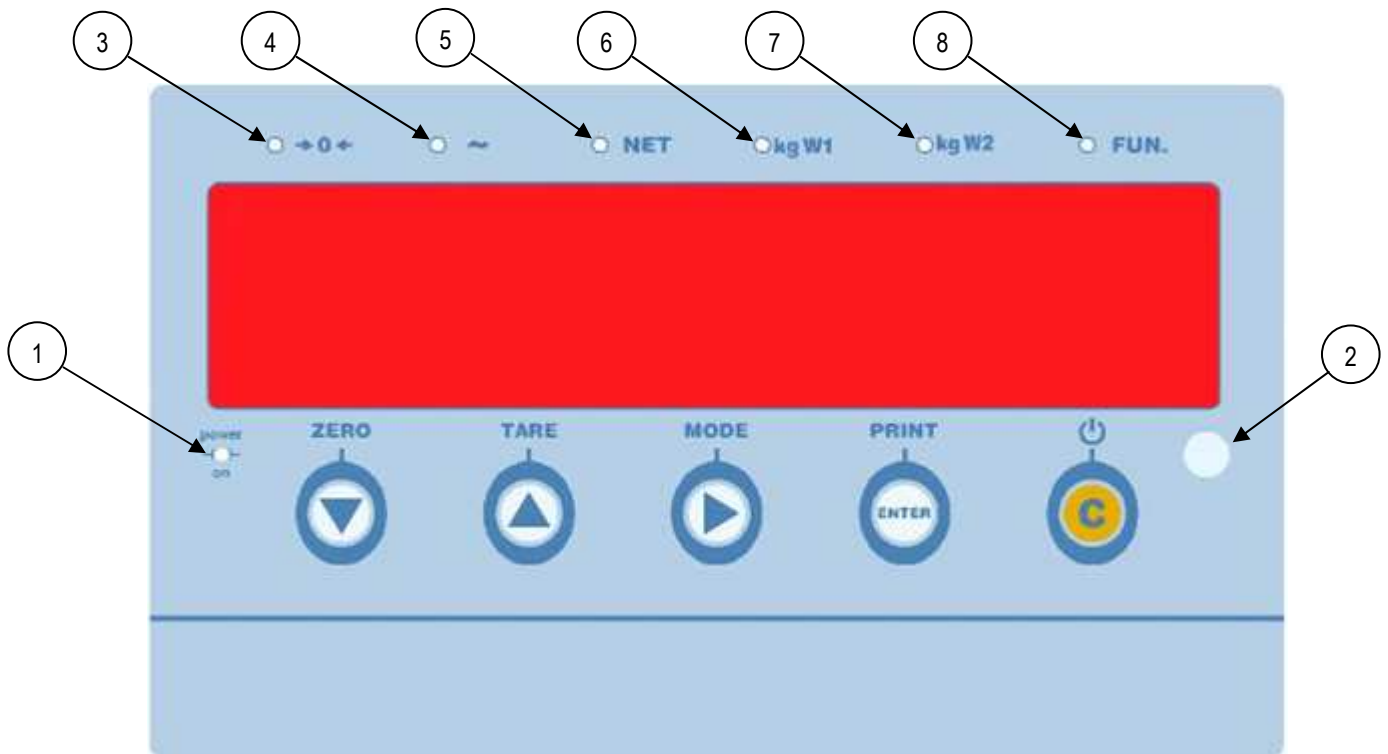


- 1** Indicates the presence of power supply.
- 2** Sensor for the reception of the infrared signal.
- 2** Indicates that the weight detected by the weighing system is close to zero, within  $\pm 1/4$  of the division.
- 3** Indicates that the weight is unstable.
- 5** Indicates that the displayed value is a net weight.
- 6** Indicates the unit of measure in use and that one is in the first weighing range.
- 7** Indicates the unit of measure in use and that one is in the second weighing range.
- 8** Indicates that a specific function of the indicator is active.


SCALE KEY	FUNCTION
<b>ZERO ▼</b>	<ul style="list-style-type: none"> <li>- Zeros the displayed gross weight, if it is within +/- 2% of the total capacity.</li> <li>- Cancels the negative tare value.</li> <li>- When entering numbers it decreases the digit to be modified.</li> <li>- If pressed for a long time, it allows to enter the USER MENU (see paragraph "USER MENU").</li> </ul>
<b>TARE ▲</b>	<ul style="list-style-type: none"> <li>- If pressed for an instant it carries out the semiautomatic tare.</li> <li>- If pressed at length it allows entering the manual tare from keyboard.</li> <li>- Cancels the negative tare value.</li> <li>- In the numeric input phase it increases the digit to be modified.</li> </ul>
<b>MODE ►</b>	<ul style="list-style-type: none"> <li>- It carries out a specific function of the operating mode set in the set-up environment.</li> <li>- In the numeric input phase it selects the digit to be modified, from left to right.</li> </ul>
<b>ENTER/PRINT</b>	<ul style="list-style-type: none"> <li>- It carries out a specific function of the operating mode set in the set-up environment.</li> <li>- In the numeric input phase, it confirms the entry made.</li> <li>- In the SET-UP, it allows to enter a step or to confirm a parameter within a step.</li> <li>- It transmits the data from the serial port dedicated to the printer.</li> </ul>
<b>C / i</b>	<ul style="list-style-type: none"> <li>- It turns the instrument on and off.</li> <li>- In the numeric input phase, it quickly zeros the present value.</li> <li>- In the SET-UP, it allows to exit a step without confirming the change made</li> <li>- Allows viewing the scale's metric information: capacity, division, minimum weigh for each configured range.</li> </ul>

**2.2.4 Symbols on the LCD display(MCW)**

The LCD display has symbols which show the indicator’s functioning status; you will find the description for each symbol below.

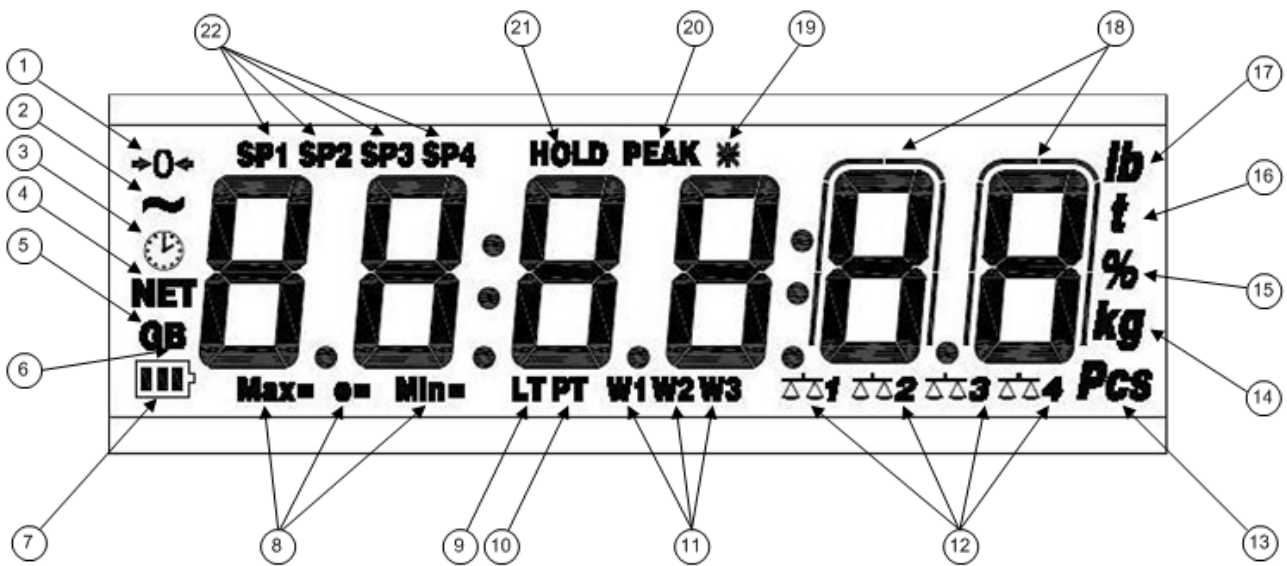

NUMBER	SYMBOL	FUNCTION
(1)	→0←	The weight detected on the weighing system is near zero, within the interval of $-1/4 \div +1/4$ of the division.
(2)	~	The weight is unstable.
(3)		The time is being shown on the display, in the “HH:MM:SS” format.
(4)	NET	The displayed weight is a net weight.
(5)	G	The displayed value is a gross weight, if the Italian or English language is selected in the print configuration.
(6)	B	The displayed value is a gross weight, if the German, French or Spanish language is selected in the print configuration.
(7)		Indicates the battery charge level: see section “LOW BATTERY WARNING”.
(8)	MAX=	When viewing the metric information, it identifies the indicated capacity range.
	MIN=	When viewing the metric information, it identifies the indicated minimum weigh range.
	e=	When viewing the metric information, it identifies the indicated division range.
(9)	LT	The locked tare is enabled.
(10)	PT	The manual tare is active.
(11)	W1	The instrument is in the first weighing range.
	W2	The instrument is in the second weighing range.
	W3	The instrument is in the third weighing range.
(12)		Indicates the number of the active scale.

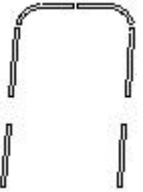(13)	<b>PCS</b>	The number of pieces is being displayed.
(14)	<b>Kg</b>	Indicates the unit of measure in use ("kg" for kilogram, "g" gram).
(15)	<b>%</b>	Indicates the percentage of the weight on the scale ("Sample Weight Percentile" functioning mode).
(16)	<b>T</b>	Indicates the unit of measure in use (tons).
(17)	<b>LB</b>	Indicates the unit of measure in use (pounds).
(18)		These are displayed around the digits with higher sensitivity, when viewing the weight x 10.
(19)	<b>*</b>	Indicates that a key has been pressed.
(20)	<b>PEAK</b>	The PEAK function is enabled.
(21)	<b>HOLD</b>	The HOLD function is enabled.
(22)	<b>SP1</b> <b>SP2</b> <b>SP3</b> <b>SP4</b>	Indicates that the $\text{Weight} < \text{Target} - t.\text{Min}$ : see section "+/- TOLERANCE CHECK (ChECK)". Indicates that the $\text{Target} - t.\text{Min} \leq \text{Weight} \leq \text{Target} + t.\text{MAX}$ : see section "+/- TOLERANCE CHECK (ChECK)". Indicates that the $\text{Weight} > \text{Target} + t.\text{MAX}$ : see section "+/- TOLERANCE CHECK (ChECK)". Indicates that the $\text{Weight} \geq \text{thresh}$ : see section "+/- TOLERANCE CHECK (ChECK)".

## 2.3 BASIC FUNCTIONS

### 2.3.1 Functioning with remote control

#### “19-key” infrared remote control

The command system is “directive”, therefore the receiving measurement device must be “in view”; the maximum functioning distance is 8 m. With this type of remote control, the functioning of the keys will be as described in the following table.

#### FUNCTION OF THE KEYS



REMOTE CONTROL KEY	KEY OR FUNCTION EMULATED
<b>F1</b>	It allows to select the desired function; see section “ADDITIONAL FUNCTIONS WITH THE 18-KEY AND 19-KEY REMOTE CONTROLS”. If pressed at length it changes the display intensity.
<b>C</b>	C key or stand-by function if pressed at length.
<b>NUMERIC KEYS</b>	Entry of digits.
<b>TARE / ▲</b>	Tare key or increase of a digit while entering a value.
<b>.</b>	. or display of scale info.
<b>ZERO / ▼</b>	Zero key or decrease of a digit while entering a value.
<b>MODE / →</b>	Mode key or it scrolls the digits to the right while entering a value.
<b>PRINT / ←</b>	Print or enter key.
<b>F2</b>	Not managed.
<b>F3</b>	Not managed.

To enable this mode one has to select “ir 19” in the << ir.ConF >> step.



## 2.4 FUNCTIONING

- 1) Suspend the instrument from the crane it will be used on and press push-button "C" for a few seconds: all segments on the display will light for a few seconds as the MCW conducts a lamp and other self-tests.
- 2) After the self-tests, if the display shows a non-zero value without a load on the scale, press the "ZERO" key.
- 3) If any accessories have been applied to the crane scale (connection rings, chains, hooks etc.) it is necessary to press the "TARE" key (or by using the remote control's TARE button).

**NOTES:**

- The "TARE" key can be used with any weight applied in the range of its capacity.
  - If slings are used to handle the load, make sure that the load is properly balanced and that the slings are positioned properly.
- 4) When the display indicates "0", the instrument is ready for use.
  - 5) Start lifting the load slowly.
  - 6) If the load is greater than the full-scale value (not maximum capacity), the display will show "-----", which means overload. Unload to avoid any need for recalibration.
  - 7) To switch off the instrument, keep the **C** key pressed until the "– oFF –" message appears on the display.

**NOTE:** for the manual containing information about the advanced functioning, contact your reseller.








**DANGER!!**




























If, during the weighing operations with the crane scale, one views the "-----" (Over Load) message, one should IMMEDIATELY stop the weighing operations and quickly place on the ground the load attached on the crane scale.

### 2.4.1 Quick reference

 <div style="display: flex; justify-content: space-between; align-items: center;"> <div style="text-align: center;"> <p>Press →</p> <p>Press 2 sec →</p> </div> <div style="text-align: left;"> <p>TARE</p> <p>MANUAL TARE (PT)</p> </div> </div>	 <div style="display: flex; justify-content: space-between; align-items: center;"> <div style="text-align: center;"> <p>Press →</p> </div> <div style="text-align: left;"> <p>ENABLE SELECTED MODE</p> </div> </div> <p><b>MODE</b></p>
 <div style="display: flex; justify-content: space-between; align-items: center;"> <div style="text-align: center;"> <p>Press →</p> <p>Press →</p> </div> <div style="text-align: left;"> <p>CONFIRM</p> <p>PRINT</p> </div> </div> <p><b>PRINT ENTER</b></p>	 <div style="display: flex; justify-content: space-between; align-items: center;"> <div style="text-align: center;"> <p>Press →</p> <p>Press 2 sec →</p> <p>Press 3 sec →</p> </div> <div style="text-align: left;"> <p>CANCEL</p> <p>ON / OFF</p> <p><b>INFO: Max, Min, e</b></p> </div> </div> <p><b>C</b> -i</p> 

2.4.2 Functioning modes

<b>STANDARD</b>	 <b>MODE</b>	Press →	SWITCH Kg / Lb
<b>NET / GROSS</b>	 <b>MODE</b>	Press →	SWITCH NET / GROSS
<b>SETPOINT</b>	 <b>PRINT ENTER</b>	Press 2 sec →	TYPE VALUE  <b>PRINT ENTER</b>
<b>IN / OUT</b>	 <b>MODE</b>	Press →	IN WEIGH → Press → OUT WEIGH
<b>ALIBI MEMORY</b>	 <b>MODE</b>	Press →	TYPE REWRITING ID  <b>PRINT ENTER</b> → TYPE ID  <b>PRINT ENTER</b>
<b>TOLERANCE CHECK</b>	 <b>MODE</b>	Press →	TARGET  <b>PRINT ENTER</b> → TOL.-  <b>PRINT ENTER</b> → TOL. +  <b>PRINT ENTER</b> → MIN WEIGHT  <b>PRINT ENTER</b>
<b>PERCENTAGE</b>	 <b>MODE</b>	Press →	TYPE % VALUE  <b>PRINT ENTER</b> →  <b>MODE</b> Press → SWITCH % - WEIGHT  <b>MODE</b> Press 2 sec → SAMPLE
<b>DISPLAY x10</b>	 <b>MODE</b>	Press →	ENABLE / DISABLE x10
<b>HOLD or PEAK</b>	 <b>MODE</b>	Press →	ENABLE / DISABLE HOLD or PEAK
<b>TOTALISER</b>	 <b>MODE</b>	Press →	SINGLE WEIGHING
	 <b>PRINT ENTER</b>	Press →	TOTAL → Press 2 sec → GRAND TOTAL
<b>PIECE COUNTING</b>	 <b>MODE</b>	Press →	TYPE PCS NR.  <b>PRINT ENTER</b> →  <b>MODE</b> Press → SWITCH PCS - WEIGHT  <b>MODE</b> Press 2 sec → SAMPLE

### 3 TECHNICAL INFORMATION

#### 3.1 PACKAGING, TRANSPORT, HANDLING, STORAGE, AND INSTALLATION

##### 3.1.1 Packaging

The instrument is shipped in a protective cardboard packaging for transport, standard.

In the packaging of the "MCW/MCWK" instrument, the following material is supplied:

- 1 lifting shackle.
- 1 lifting eye hook.
- External power (12Vdc)
- Infrared remote control.
- Instruction manual (CD or paper).
- Certificate of calibration.
- Certificate of internal control of the manufacturer (which serves as a reference for periodic inspections).
- CE Declaration of Conformity.
- REGISTER FOR MAINTENANCE AND WARRANTY.

Before making the first user verification, make sure that the package contains all the items in the above list and that the material has not been damaged during the transport.

##### 3.1.2 Transport, handling, storage

During transportation of the electronic crane scale, it is obligatory to use their package that protects the instrument from impact or falls.

For transportation, one must consider that the package should not be compressed in neither the top nor side by any external bodies.

It is important that the board and the electronic crane scale itself are stored indoors to meet the environmental conditions mentioned above (see paragraph "ENVIRONMENTAL CONDITIONS").

The weight of the box varies depending on the model:

MODEL	SIZES mm (l x w x h)	WEIGHT(including packing)
MCW150R2	480X300X400	19(21) kg
MCW300R2	480X300X400	19(21) kg
MCW600R2	480X300X400	19(21) kg
MCW1500R2	480X300X400	19(21) kg
MCW3000	480X300X400	14(16) kg
MCWT6	480X300X400	14(16) kg
MCWK6	480X300X400	19(21) kg
MCWK8	480X300X400	21(23) kg

Sizes:

Length (l) x width (w) x height (h)



**CAREFUL!!**



Take care when handling the package to avoid collisions or falls that could be harmful to humans and / or instrument. If necessary, carry out the handling procedure with the help of various people or with the appropriate aids.

### 3.1.3 Installation

Inside the package, all provided parts of the system are placed. The equipment is not provided ready to use, consequently it must perform certain operations in order to start the instrument.

The installation steps are:

- Open the box containing the electronic crane scale.
- Install the "shackle" on the upper side of the load cell.
- Install the "eye hook" on the rotating body.
- Make sure that the nut shackle is quite screwed and that the pin is well placed.
- Make sure that the shackle is completely screwed.
- Carefully check the suitability of the crane hook in which the crane scale will be installed.
- Connect the system to the safety hook of the crane, taking care that the "shackle" rests on the saddle of the crane hook and its lever is safely positioned.
- The system slinging completed, go properly away and lift a few inches the crane scale.
- The crane scale is supplied with battery already installed. Thus, pressing the C button on the front panel, the electronic crane scale can be switched on and used immediately.



**CAREFUL!!**



If it's necessary to replace the hook and/or the shackle use original spare parts that are marked CE, with the same capacity as the replaced one.

## 3.2 MAINTENANCE AND CHECKS

The electronic crane scale and all lifting accessories must be regularly maintained.

For the prevention of accidents or damages, it is necessary that the maintenance is done according to the manufacturer's instructions. Maintenance must be performed only by persons who have acquired the necessary technical expertise.

To ensure a safe operation, follow these instructions:

- carry out a continuous regular maintenance and cleaning.
- entrust the maintenance and repair operations only to trained and authorized personnel or to the Dini Argeo service dept.
- use only original spare parts.
- do not use the electronic crane scale where there is non-compliance with the safety checklist.
- any maintenance, repair or cleaning should be done with the electronic crane scale turned off.

### 3.2.1 Daily monitoring

Each time the operator starts a new work cycle with the electronic crane scale, one must:

- check all instrument parts;
- carry out a general visual inspection of the whole system;
- check the integrity and efficiency of all parts of the weighing system like the safety lever of the hooks, the locking nuts screwed well with the pin, the shackles, etc..

**3.2.2 Regular Maintenance**

Maintenance should be carried out only by persons who have acquired the necessary technical expertise and are specialized and trained for this purpose.

<p><b>Every 3 months or, in any case, after 12.500 weighs</b></p>	<ul style="list-style-type: none"> <li>- Check all dimensions of the parts which make up the instrument;</li> <li>- Check the wear on the handle or the eyelet, by checking if there are any plastic deformations, mechanical damages(irregular), cracks, corrosion, damage to threaded portions and the twists;</li> <li>- Check the tightness of the splice plate on the hook, and the presence of defects, and ensure its proper functioning;</li> <li>- Make sure that the split pin and the shackle nuts are firm;</li> <li>- If other metrological and mechanical irregularities are detected, have the electronic crane scale repaired by qualified personnel (Dini Argeo assistance service).</li> </ul> <p>Do not for any reason carry out the repair by yourself. In case of non-compliance turn immediately off the electronic crane scale.</p> <p>All repair operations and the parts used are classified and stored in the maintenance register.</p>
<p><b>Every 12 months or, in any case, after 50.000 weighs</b></p>	<p>The extraordinary maintenance of the product should be made by specialized personnel (Dini Argeo assistance service).</p>




It is of utmost importance that all the maintenance and repair operations, and the used pieces are recorded and filed in the appropriate produce maintenance registry.

For further information on regular checks, see the following table:

COMPONENT	PART	CONTROL	LIMIT	REMEDY	SOLUTION
<b>Shackle</b>	Locking bolts	<ul style="list-style-type: none"> <li>Loosening</li> </ul>		Tightening	<p>In order to replace the damaged parts, contact personally the manufacturer.</p> <p>In case of replacement of the original parts, use only original spare parts.</p>
	Pivot	<ul style="list-style-type: none"> <li>Deformation</li> </ul>			
	Shackle surface	<ul style="list-style-type: none"> <li>Wear</li> <li>Deformation</li> </ul>			
	Split pin	<ul style="list-style-type: none"> <li>Positioning</li> </ul>		Full insertion of the split pin in the pivot	
<b>Hook</b>	Eyelet and hook surfaces	<ul style="list-style-type: none"> <li>Mechanical damages</li> </ul>			
	Eyelet and hook	<ul style="list-style-type: none"> <li>Wear</li> <li>Corrosion</li> </ul>	Current size > 95% compared to the initial sizes		
	Eyelet	<ul style="list-style-type: none"> <li>Orientation of the eyelet</li> </ul>	Can not be torque		
	Hook opening	<ul style="list-style-type: none"> <li>Deformation</li> </ul>	Deformation > 10% of the original sizes		
	Squint Hook	<ul style="list-style-type: none"> <li>Tension</li> </ul>	Tension > 10°		
	Safety Splice plate	<ul style="list-style-type: none"> <li>Damages</li> </ul>			
<b>Instrument</b>	Locking screws	<ul style="list-style-type: none"> <li>Loosening</li> </ul>		Tightening	

Form and structure of the shackle:

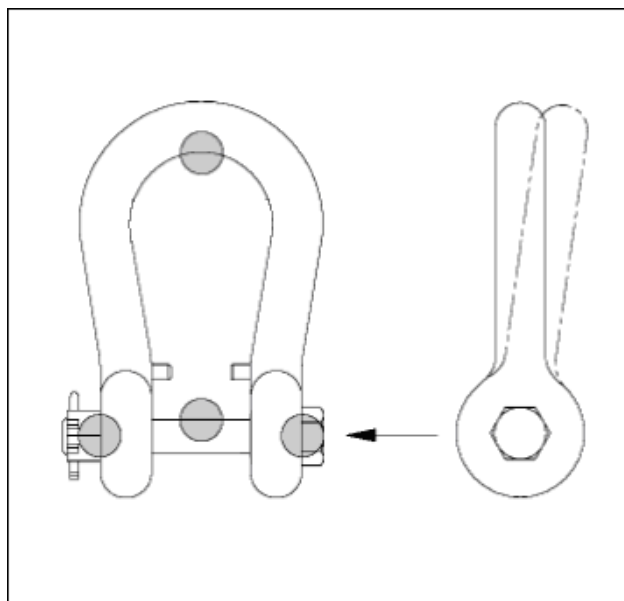


The shackles should be examined regularly by a qualified person. The time interval from one check to another depends on how much the instrument is used, but it is recommended to not exceed six months.

Therefore, one must:

- always inspect the shackle before use;
- carry out regular visual inspections to look for nicks, cracks, wear or damaged areas, damaged threads on the pivot and body; if it is necessary, carry out a magnetic test or non-destructive testing;
- keep a file in regards to the accessory sheet and keep track of the checks;
- the shackles which do not fully or partially satisfy the requirements, must be discarded.

Form and structure of the hook:

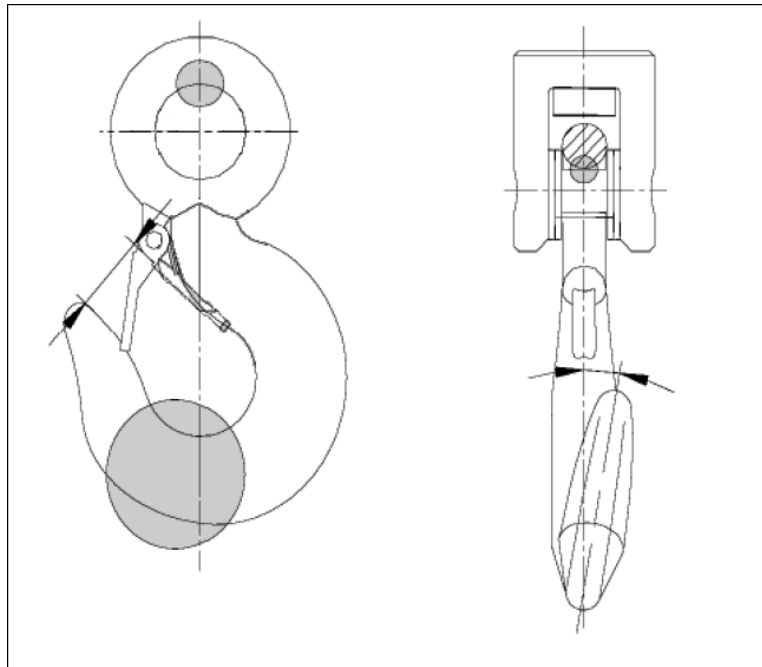

The eye hook should be examined periodically by a competent person. The interval among the inspections depends on the frequency of use of the instrument, but it is recommended not to exceed six months.

Therefore, during:

- a visual inspection (monthly): He must perform a cold cleaning and check for worn parts, burrs, cracks. As to fork hooks, make sure that the pivot is not worn or deformed and it slides into its place. The hook cannot be deformed. The spring must be positioned the hook correctly on the tip of the hook. As to locking hooks, make sure the locking system works properly and ensure the safety closure, which in these conditions must lean on the hook without leaving open spaces and should not oscillate side to side.
- Dimensional (quarterly) pay particular attention to:
  - **Entrance:** it must not exceed 10% of the nominal size.
  - **Worn parts:** next to where the slings are rested and to the maximum stress section the worn parts must not be inferior to the 95% of the original size of their original sizes (see next figure). The markings must be legible.
  - **Misalignments:** to the plane of symmetry.
  - **The hub:** the diameter should not be less than 10% of the nominal value.
  - **The eye:** the reduction of the section in a perpendicular direction should not be greater than 10% compared to the nominal diameter.



Is the zone of maximum tension, the area where the hook is stressed at the physical level.



Is the zone of maximum wear, because it is the point where the load is lifted and the materials they touch.

The hooks, which do not pass the checks laid down, must be eliminated and substituted

### 3.2.3 Maintenance registry

In order to cope with problems like the wear of the mechanic and electronic components, and the grip load devices, it is necessary that one carries out a regular and systematic maintenance.

The maintenance and respective time intervals must take place according to the indications of the manufacturer shown in the instructions manual of the instrument.

The maintenance interventions must be made only by specialised and qualified personnel.

The maintenance person must have attended training courses and must know the safety norms in the use of crane scales and concretely apply them.

In this booklet the user must document in chronological order all the maintenance interventions carried out on the crane scale (inspection/control, revision, repair), as well as any fact or particular event which might have influenced safety matters.

In the following pages of this booklet there is a “maintenance registry” in which all ordinary and extraordinary maintenance interventions on your instrument, should be reported.

All information is very important and can invalidate the validity of the warranty in the case that it's not reported in detail and accurately. It is also advisable to make sure that:

- the internal responsible person carries out the quarterly verification and regularly records it on this booklet;
- the Dini Argeo authorised personnel stamps the appropriate box at the end of each annual maintenance intervention.

#### NOTE:

This manual is an integral part of this instrument, and therefore it is necessary that it accompany each maintenance operation or instrument return.

**The maintenance registry is situated at the end of the manual.**



### 3.2.4 Clean

If the electronic crane scale is often used in different places, especially in places with the presence of dust and moisture, it is necessary to have the instrument regularly cleaned.

Clean the keyboard of electronic crane scale with a soft damp cloth with a detergent or a mild detergent solution.



**CAUTION!!**




Do not use any type of solvent or industrial chemical product while cleaning the instrument and all the system parts.

### 3.2.5 Replacing the remote control batteries

As mentioned above, the MCW electronic crane scale is supplied with a remote control that duplicates the functions of the keyboard. When using the remote control, the battery may die and must be replaced.

To replace the batteries in the remote control, carry out the following steps:

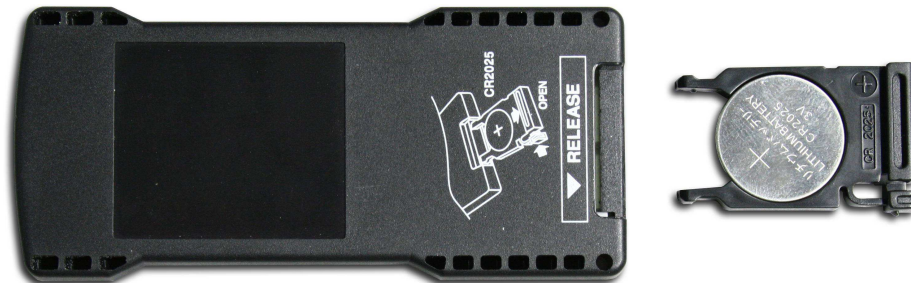

- take out the battery box placed on the back of the remote control;
- replace the old battery with a new one and make sure that it's correctly inserted;
- reinsert the box with the new battery in the remote control.

### 3.2.6 Electronic crane scale battery: instructions and recharge

As mentioned earlier, the power supply in MCW/MCWK electronic crane scale is provided through a rechargeable 6V – 4,5 Ah, to be included in the box on the back of the equipment (see section “MAIN COMPONENTS”).

In order to prevent problems with the battery, it is recommended to remove the battery from the load cell, if the electronic crane scale is not used for a long time so as not to cause damage to both the battery and the crane scale itself.



**CAREFUL!!**



Never throw the battery into the fire, will bring them closer to sources of heat can cause explosions and injuries.

The electronic crane scale displays "LoW.BAt" when the batteries are about to complete their life cycle. In this case, it is necessary to connect the crane scale to external power (12Vdc) to fully recharge the battery.

In order to recharge the battery, you must:



- Remove the rubber cap from the connector on the back of the crane scale;
- Insert the jack of the feeder (12V) in the connector on the back of the instrument;
- Insert the power supply (12V) in the power outlet at 230VAC;


Later, on the indicator front panel lights the LED power-on LED lights.

### 3.2.7 The battery recharge by optional kit


If there would need to use the MCW/MCWK crane scale constantly, it is possible to request an optional kit including a spare battery pack and charger adapter.

To perform a battery change and development its functions, perform the following steps:


- 1) Unscrew the screws "manual" on the back of the machine..

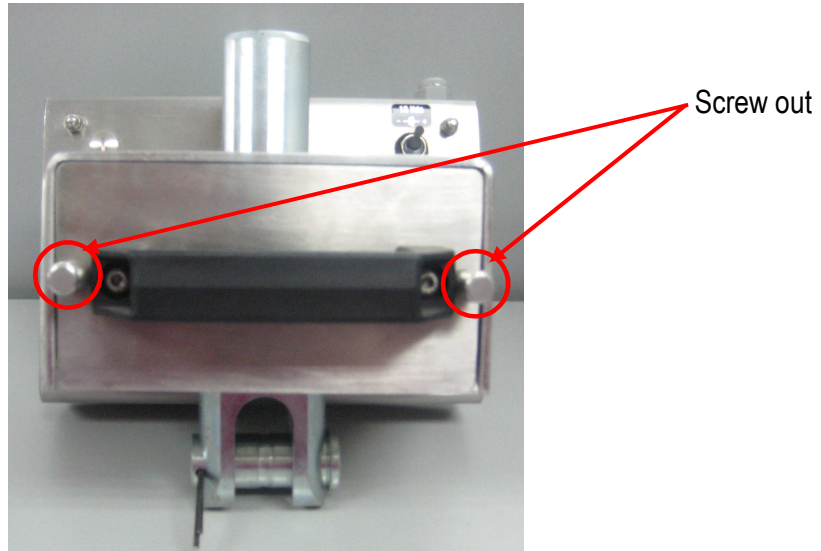


- 2) Slowly remove the battery pack.
- 3) The battery is connected internally to the electronic card of the instrument thanks to an AMP automotive connector.

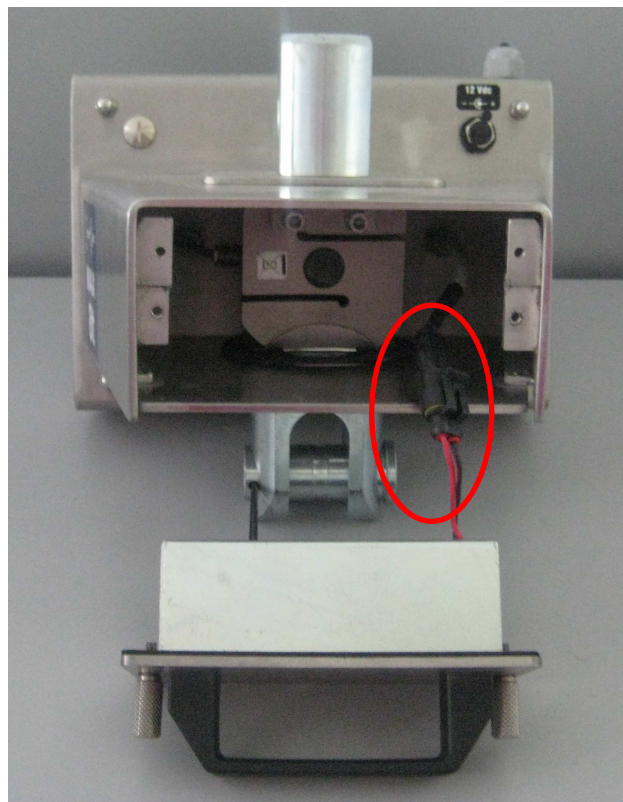


- 4) Unplug the connector automotive AMP from the battery pack.

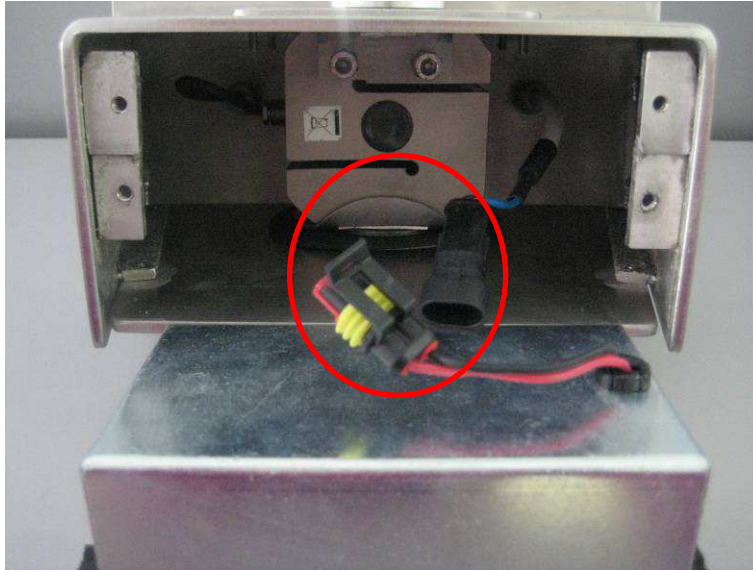

- 5) Connect the charger to the battery pack by the auto-motive AMP connector.

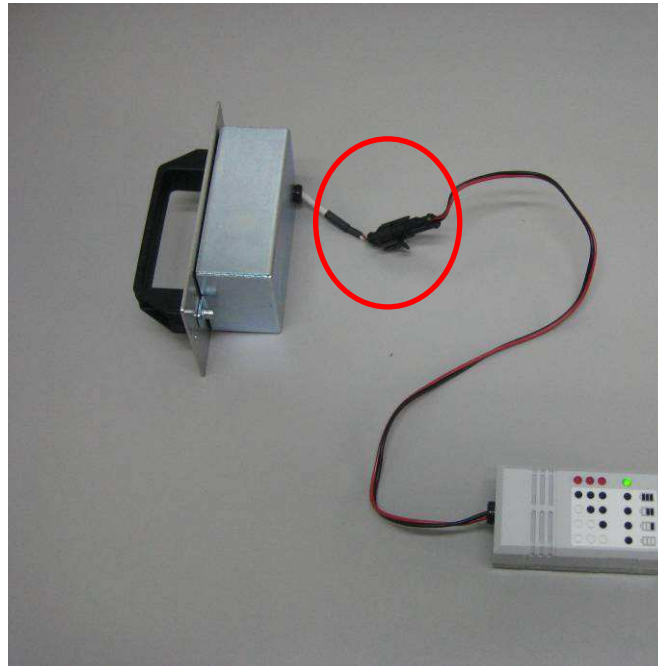

- 6) Insert the power supply (12Vdc) to the network at 230Vac and plug the charger by the connection jack.

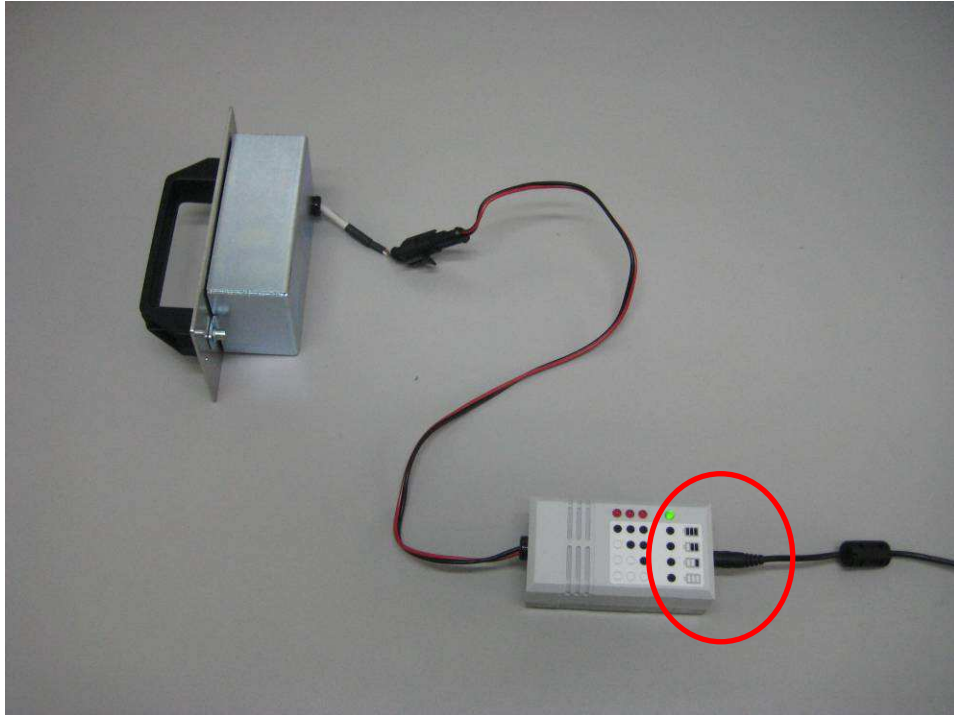

Once the battery is charging, it is possible to connect the spare battery pack to the crane scale.




**CAREFUL!!**



The battery recharge must be performed using only the power supplied (12Vdc) supplied with the instrument.

## PHASE OF THE BATTERY RECHARGE BY CHARGER ADAPTER

The charger's led indicate the charge level reached:

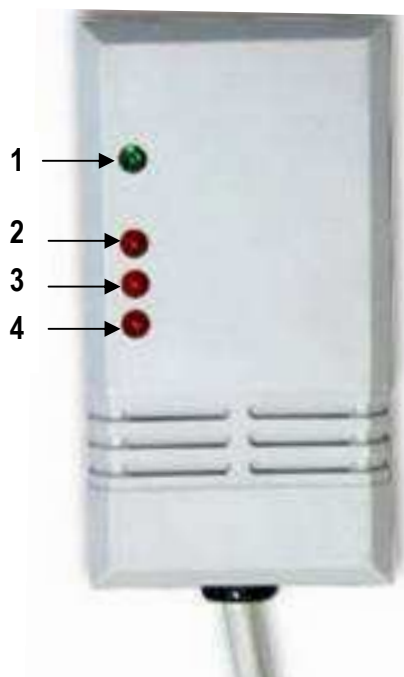

LED	DESCRIPTION
1	When lit, it indicates the presence of voltage.
2	When lit, it indicates the presence of the battery; it means that the battery is connected correctly to the charger.
3	When lit, it indicates that the battery is half charged .
4	When lit, it indicates that the battery is fully charged.

Once the full charge reached:

- Disconnect the power supply charger.
- Disconnect the battery charger.

### 3.3 DECOMMISSIONING AND DISPOSAL

Each consumer should help protect the environment by reducing pollution risks and adopting a responsible attitude, according to the recycling norms in force in the country where the instrument is used.

The symbol of the crossed garbage on the product indicates that, at the end of its useful life, the product must be given to appropriate centres for collection or returned to the distributor when purchasing a new equivalent product.

A proper collection for recycling the product will prevent any negative effects on the environment and health and encourage the recycling of materials.

Therefore, before disposing the product, it is necessary to separate the components of the instrument in each recycling category and place them in the appropriate collection centres.



The unlawful disposal of the product by the user causes the application of the administrative sanctions foreseen by the law.



## 4 WARRANTY

The two years warranty period begins on the day the instrument is delivered. It includes spare parts and labour repair at no charge if the instrument is returned prepaid to the dealer's place of business. Warranty covers all defects not attributable to the Customer (such as improper use) and not caused during transport.

If on site service is requested (or necessary), for any reason, where the instrument is used, the Customer will pay for all of the service technician's costs: travel time and expenses plus room and board (if any).

the Customer pays for the transport costs (both ways), if the instrument is shipped to dealer or manufacturer for repair.

The warranty is voided in the event that the instrument is returned or if there are damages caused by: inobservance of indications in the manual, interventions by non authorised personnel, and/or non original spare parts, user incapacity and/or improper use, incorrect maintenance, loss or impossibility of presenting the maintenance booklet.

This warranty does not provide for any compensation for losses or damages incurred by the Customer due to complete or partial failure of instruments, even during the warranty period.